

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER

R 94-17985

INITIAL CUSTOMER ORDER NO.

FPS

W/PACHMAYR RECOIL PAD

DATE RECEIVED

DATE OPENED

DATE CODE

SERIAL NUMBER

NEW SERIAL NUMBER

MODEL AND GRADE

06/08/94

06/09/94

RD 11-83

B6521567

700

30-06

BDL

ACCESSORIES

W/STUDS

L/SIGHTS

Set up file

FROM:

PENA, Y. H.
711 W. ALLEN ST.
FALFURRIAS

TX 78355

SHIP TO:

PENA, Y. H.
711 W. ALLEN ST.
FALFURRIASTX
78355

CUST NO: 098398 C.B.D L

ACCOUNT NUMBER

ACCOUNT NUMBER NYC

WRITE ☐

FROM DATE

ESTIMATED

VIA

UPS

GUN CONDITION

☐ NEW☐ LIGHTLY WORN☒ WORN☐ VERY WORN☐ UNREPAIRABLE☒ MARRED

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

20

8

28.00

CUSTOMER CONCERN

AMMO

FUNCTION

FINISH

ACCURACY

FIT

INSPECT

CYCLE

A1

B1

TRIGGER GROUP

BOLT ASSY.

B3

BARREL ASSY.

B4

REC. ASSY.

B5

WOOD

C1

D3

E5

F5

METAL

C2

MAIN FAULT

Mya 11-83 Unable to duplicate customer concern as noted. Trigger components, sears, trigger housing were gummed up apparently from dried lubricant. Had oil like old motor oil. Gun components should only be oiled with a light film of light oil to prevent rusting. See owners manual. Exchange trigger assy at a special price as a gesture of good will and to restore customer confidence in rifle.

PARTS

COMMENTS

*Trigger pull measured 3 3/4 lb
2 1/4 lbs as noted sear lift
was .013*

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

OFFICE COPY

RD8925 REV. 1/84

PS04962