

CLARKS GREEN, PA 18411

SHIP TO:
SHIPPER: DON
207 FAIRVIEW RD
CLARKS GREEN PA
18411

ACCOUNT NUMBER: N/C

WRITE ☐

CLEAN/TEST

FROM DATE

ESTIMATED

VIA

12-21-90

UPS

REPAIR CHARGE

23.60

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

GUN CONDITION:

☐ NEW

☒ SLIGHTLY WORN

☐ VERY WORN

☐ MISUSED

☒ MARRED

CUSTOMER'S REQUEST

"This weapon discharged twice when safety was released"

MAIN FAULT

No fault found - could not duplicate complaint - Trigger
and safety assembly operate properly. However, trigger assembly
has been adjusted out of factory (foreign adjust) improperly. Trigger
will be below our min. spec at 2.3, #, over travel is insufficient.
Seri - lift O.K. at .008"

PARTS

26345 - trigger assembly
New style safe
(will open on safe.)
1/2 Price

Offer to properly readjust present
trigger assembly or, if it will
better restore confidence in the up,
we can install a new trigger assembly
at 5 pound cost, as a gesture of
good-will.

Polished chamber
fit & adjusted
work done

REPAIRMAN

LEG

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

OFFICE COPY

RD6923 REV 7/90

PS05539

RECEIVING AND ESTIMATING REPORT

COMMENTS

ATTN JIM STEKL

INITIAL
LCS

CUSTOMER ORDER NO.

DATE RECEIVED
12/14/90

DATE OPENED
12/19/90

DATE CODE
EY 10-74

SERIAL NUMBER
6796517

MODEL AND GRADE
700 30-06 BDL

ORDER
R 90-33235

ACCESSORIES
W/STUDS

FROM:

SHIFFER, DON
207 FAIRVEIW RD
CLARKS GREEN PA 18411

SHIP TO:

SHIFFER, DON
207 FAIRVEIW RD
CLARKS GREEN

PA
18411

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

CLEAN/TEST

FROM DATE

ESTIMATED

VIA

UPS

REPAIR CHARGE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

GUN CONDITION:

☐ NEW

☒ SLIGHTLY WORN

☐ VERY WORN

☐ MISUSED

☐ MARRED

CUSTOMER'S REQUEST

"This weapon discharged twice when safety was released"

MAIN FAULT

No fault found - could not duplicate complaint - Trigger
and safety assembly operate properly. However, Trigger assembly
has been adjusted out of factory (trigger sear) improperly. Trigger
will no longer run. spec at 2.3, 1. Over travel insufficient.
Sear - left O.K. at .008"

PARTS

Offer to properly re-adjust present
Trigger assembly at 2.3, if it will
let the customer confident in the up,
we can install a new Trigger assembly
at 2 normal cost, as a gesture of
good-will.

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

QUALITY TESTER

DATE

DATE

DATE

DATE

DATE

100-0025-001-00790

PS05540