

5/4/94

Standridge, Scott

94 14895

NO Fires on safe release fails to cock

- Trigger has a 'click' or catch in it even with bolt out safe on or off
- Stock not of our mfg.
- Trigger pull 4 to 4 1/2 lbs
- Sen lift .0135
- Note - 'click' / catch went away when action was removed from stock
- on re assembly 'click' / catch came back
- ^{Noticed} Noted that the trigger did not have any clearance in trigger guard and was binding.
- Also: Bolt ~~has~~ lug hits front guard screw on closing.