

ORDER
R92-15318

L/FLOOR PLATE, SCREWS
ATTN: HERB BROWN

DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	NEW SERIAL NUMBER	MODEL AND GRADE
7/17/92	07/29/92	KS 5-69	6239535		700 243 WIN VAR
ACCESSORIES	L/WOOD	L/FOLLOWER	L/MAG SPRING		
		L/REAR SIGHT			

SHIP TO:

SHRIVER, ROBERT E
1605 HUFFMAN DR
WARREN

OH 44481

SHRIVER, ROBERT E
1605 HUFFMAN DR
WARREN

OH
44481

CUST NO:064241 C.O.D L

WRITE ☐ CLEAN/TEST

VIA
UPS

☐ NEW
☐ LIGHTLY WORN
☒ WORN
☐ VERY WORN
☐ UNREPAIRABLE
☐ MARRED

合 成 合 成

INSPECT

ROLE	A1	<i>Firefighter</i>	<i>accidently - per attached letter</i>		
BOSS GROUP		B2		E3	F1

BIGGER GROUP

OLT ASSY.

ARREL ASSY.

EC. ASSY.

DOD

ETAL.

IN FAULT 7

maximizing pull adjustment and over-travel screws. Observed incident could be duplicate, because trigger pull was misadjusted on light (2 pounds), there was no integrating spring, broke left to keep trigger under rear safety cam trigger pull 2nd from left .008

NOTE - Customer request O.S. Safety

COMMENTS

We adjust present trigger assembly to our minimum spec - $3\frac{1}{2}$ pounds, 02,

2) Offer new trig assembly at a normal cost, as gesture of good will, set at 25 pounds.

PATTERN	
---------	--

DATE _____

RD6925 REV. 1/92

PS05911