

RECEIVING AND ESTIMATING REPORT

INITIAL		CUSTOMER ORDER NO.		COMMENTS			
WJS				<i>file</i>			
DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	MODEL AND GRADE		ORDER	
12/05/89	12/08/89	ER 10-68	366134	700 22-250 ADL		R 89-30120	
ACCESSORIES		W/STUDS		SCOPE BASE		L/SIGHTS	

FROM:

VERNON TUCKER
1200 OAK STREET
BURNET TX 78611

SHIP TO:

VERNON TUCKER
1200 OAK STREET
BURNET

TX
78611

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	PROM. DATE	ESTIMATED	VIA
					UPS

REPAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL

GUN CONDITION:

☐ NEW

☒ SLIGHTLY WORKED

☐ VERY WORN

☐ MISUSED

☐ MARRED

CUSTOMER'S REQUEST

1) "This gun discharges when loading or unloading"
2) bolt face shows brass on closing bolt.

1) no fault found - operates normally trigger pull 4 3/4#, Sem-lift .006"
2) Extractor and rivet not set properly, replace extractor N/C

PARTS

Replace trigger assembly at N/C, per
phone call to customer (same style
safety - bolt lock)
2) Lubricate bolt lugs - slight galling.
Charge \$10.00 handling plus return
shipping

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

RD5925 REV. 6/88

PS06110