

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER

R 94-20277

WOG 1 OF 2

INITIAL CUSTOMER ORDER NO

JJM

DATE RECEIVED

DATE OPENED

DATE CODE

SERIAL NUMBER

NEW SERIAL NUMBER

MODEL AND GRADE

07/01/94

07/06/94

XS 12-69

6302584

700 243

ADL

ACCESSORIES

SCOPE BASE

FROM:

SHIP TO:

TAMPA SPORTS UNLIMITED
4545 HILLSBOROUGH AVE
TAMPA

FL 33614

TAMPA SPORTS UNLIMITED
4545 HILLSBOROUGH AVE
TAMPA

FL

33614

CUST NO: 007955 WILM

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

PROM. DATE

ESTIMATED

VIA

063103

7-12-94

UPS

GUN CONDITION

- ☐ NEW
☐ LIGHTLY WORN
☐ WORN
☐ VERY WORN
☐ UNREPAIRABLE
☒ MARRED

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

*Trigger Assy SP# 20.00 Part
Plus parts*

| CUSTOMER CONCERN | AMMO | FUNCTION | FINISH | ACCURACY | FIT | INSPECT |
|------------------|------|----------|--------|----------|-----|---------|
| CYCLE | A1 | B1 | | | | |
| TRIGGER GROUP | | B2 | | | | F1 |
| BOLT ASSY. | | B3 | | | E2 | F2 |
| BARREL ASSY. | | B4 | | D1 | E3 | F3 |
| REC. ASSY. | | B5 | | D2 | E4 | F4 |
| WOOD | | | C1 | D3 | E5 | F5 |
| METAL | | | C2 | | | |

MAIN FAULT

Sent to product service. Microscopic evaluation of components shows rust inside of trigger housing around trigger pivot hole and hardened (solidified) lubricant. Seer engagement screw appears to have been adjusted outside of the factory and re-sealed. We do not recommend that the trigger be adjusted outside of the factory. Exchange trigger assy at S.P. as gesture of good will. Stock is chipped, broken front sight

PARTS

COMMENTS

** Received w/ trigger removed and has a broken counter for at trav hole.*

See owners manual for maintenance and lubrication instructions.

Bluing is missing from trigger housing left side plate (Rost color)?

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

OFFICE COPY

RD6925 REV

PS06150