

RECEIVING AND ESTIMATING REPORT

CUST NO: 050773 C.O.D

COMMENTS

TOTAL PS	CUSTOMER ORDER NO.					
DATE RECEIVED 0/07/91	DATE OPENED 10/09/91	DATE CODE WR 8-68	SERIAL NUMBER 365767	MODEL AND GRADE 700 243 WIN ADL		ORDER R 91-20313
ACCESSORIES W/STUDS		L/SIGHTS		SCOPE BASE		

FROM:

TINSLEY, JACK
BOX 183
LIVINGSTON
USA

MT 59047

SHIP TO:

TINSLEY, JACK
BOX 183
LIVINGSTON
USA

MT
59047

COUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	CLEAN/TEST	PROM. DATE	ESTIMATED 10-18	VIA UPS
--------------	--------------------	--------------------------------	------------	------------	--------------------	------------

PAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
-------------	-----	-----------	-----	-------------	-------

IN CONDITION:

☐ NEW

☐ SLIGHTLY WORN

☐ VERY WORN

☐ MISUSED

☐ MARRED

STOMER'S REQUEST

discharged while closing the bolt

IN FAULT

Cannot duplicate complaint. However, examination of trigger assembly revealed the inside is contaminated with a greasy, oily substance. The rear-safety cam is not moving properly, due to substance on inside of trigger-side-plate. Trigger pull measured at 4 3/4 #; rear-lift .009"

Due to age of rifle offer new trigger assembly at 1/2 normal cost as a gesture of good-will

REPAIRMAN BSW	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

RD6925 REV 7/90

PS06240