

Gun As Rec'd. During Initial Examination

- Receiver Is Discolored - Reddish Color As A Result Of Poor Blue Process - Magazine Retaining Screw Missing - Gun Overacc Appears To Have Been Used
- Trigger Assembly As Rec'd. Has Excessive Overtravel And Acceptance Engagement - Debris Is Visible Inside And Is Oily - Bolt Stop Release Is Extremely Greasy Bolt Stop Pivot Pin / Sear Pivot Pin Show Evidence Of Being Removed
- Trigger Pull Is Within Factory Specs ~~But~~ All Screws Show Evidence Of Being Tampered With
- This Rifle Has Had Front Guard Screw Tightened As To Bear On Rt Lug Of Bolt - Bolt Has Had Safety Bound In Cock Cam And Has Been Forced (Attempted) Open