

REIVING AND ESTIMATING REPORT

COMMENTS

to Product Service

ORDER
R 94-06409

CUSTOMER ORDER NO.

CEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	NEW SERIAL NUMBER	MODEL AND GRADE
15/94	02/21/94	KI 5-88	C6260561		700 270 ADL

CRIS W/STUDS

Set up file
L/REAR SIGHT

SHIP TO:

VASS-KAPP HARDWARE & FURN
PO BOX 107
CORNER MAIN & GRAYSON ST
GALAX VA 24333

VASS-KAPP HARDWARE & FURN
PO BOX 107
CORNER MAIN & GRAYSON ST
GALAX VA 24333

CUST NO: 007000 ILIONL

ITEM NUMBER	ACCOUNT NUMBER NC	PROM. DATE	ESTIMATED	VIA
				UPS

WRITE ☐

NOTION	<i>Appearance of exterior</i> <i>5P Trigger 15.00</i> <i>clean 5.00</i> <i>Add. H Space NE</i> <i>1" inletting NB</i> <i>ship 8.00</i>	REPAIR CHARGE	20.00
HTLY WORN		EXCISE	
FN		TAX	
LY WORN		INSURANCE	
REPAIRABLE		UPS	8.00
RED		PARCEL POST	
		TOTAL	28.00

OWNER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
	A1	B1				
ER GROUP		Unable to close bolt on Remington Ammunition				
SSY.		B3			E2	F2
L ASSY.					E3	F3
SSY.		B5			E4	F4
			C1	D3	E5	F5
			C2			

GUN mfg 5-88 Unable to duplicate customers complaint - gun will not spring fire or malfunction in any manner. Removed action from stock - underside of action and trigger Assy loaded with debris. Firing pin head, connector and sear gummed up with shellac like substance. Improper care and maintenance. Clean action. Increase headspace. Adjust inletting and Replace trigger Assy at special price as gesture of good will.

COMMENTS

Trigger pull measured 6# as Rec'd
5000 lb ft was .012
Perform all new gun inspections
For Function.

REF

REPAIRMAN PROOF CLEAN TEST TARGET PATTERN