

RECEIVING AND ESTIMATING REPORT

COMMENTS

INITIAL LCS	CUSTOMER ORDER NO.					
DATE RECEIVED 09/07/90	DATE OPENED 09/19/90	DATE CODE 00 7-77	SERIAL NUMBER A6485963	MODEL AND GRADE 700 30-06		ORDER R 90-24163
ACCESSORIES L/MAG BOX		L/WOOD	L/FOLLOWER	L/MAG SPRING	L/SIGHTS	
L/FLOOR PLATE						

FROM:

VILLMANN, ALAN E
LEXINGTON HILL CONDO I-2
HARRIMAN NY 10926

SHIP TO:

VILLMANN, ALAN E
LEXINGTON HILL CONDO I-2
HARRIMAN NY
10926

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	PROM. DATE	ESTIMATED	VIA V437818695
----------------	--------------------	--------------------------------	------------	-----------	--------------------------

REPAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
---------------	-----	-----------	-----	-------------	-------

GUN CONDITION:

CUSTOMER'S REQUEST ☐ NEW ☐ SLIGHTLY WORN ☐ VERY WORN ☐ MISUSED ☐ MARRED
refire firing when safety was released

MAIN FAULT
1) Trigger pull adjusted too light ($2\frac{1}{2}\#$ below spec.) out of factory.
2) Trigger assembly contaminated with excessive lubrication; internal part not moving freely. Trigger adjustment is not consistent.
Rifle operates acceptably at room temperature, however, cold temperatures could cause problems.

PARTS	Per phone call to customer on 10/16/90 —					
	1) replace trigger assembly with new one at $\frac{1}{2}$ normal price (based on age of rifle)					
	2) adjust trigger pull to $3\frac{1}{2} - 4\#$					
	3) return rifle C.O.D.					
	4) please expedite & ship asap.					
REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN	
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE	

RD6925 REV. 6/88