Remington Arms Co., Inc. Product Service Legal Case #:2601

Case Information

RE# Date Opened Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete
148948 8/8/2008 8/13/2008 8/13/2008

Customer Information

City Zip Age Contact Type Business First Name Last Name Street State H 417-934-1569 8500 County Rd 3940 W 417-934-2291, ext 233 Incident Kevin Conner Mountain View MO 65548 C417-247-0971

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

PD Scope hole damaged in receiver Cause:4006 Altered Adjustments or Components Unit Concern:1007 Fired on Safe Release

Unknown

S Fired on Safe release

C

Blocker was not returning trigger under sear due to altered adjustments. Scope hole in receiver was damaged by customer - he broke the screw off in the hole and damaged the hole further trying to remove the broken piece.

Firearm Information

SKU Mfg. Type Model/Ga. Serial Bbl. DOM CF/BA 700/7mm Rem Ma 27047 G6636738 BB 1/16/2007 10:48:21 PM Remington **Date Purchased** Accessories **Original Owner** Where Purchased SIMMONS GUN SPECIALTIES I U

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Settlement Reim. Date APV Cash Date APV

Repair/Replacement Cost Repair/Replacement Date

8/13/2008 Returned to AS to try to repair the scope hole - if it is not repairable we will quote the customer for a new barreled action at 1/2 normal charges and install a new TA fls.

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment	27.26
	Examiner]	Supry	77.26
	Exam Date]	8/13/2008	
Examination	Product Type]	RF	
	Action Type]	A	
	Assigned To	}	Supry	
Cause	4006	Altered Adjustments or Components	Blocker adjusted improperly. Scope mount hole damaged by customer	
	Description]	26 inch Model 700 7mm Rem Mag	
	Date Code]	BB	
	Bore Plugged	False		
Barrel	Bulged	False		•
	Fired	False		
	Fired while Obstructed			
	Muzzle/Crown			

.

	Condition	Like new; Functioning]	
	Firing Pin	Slightly Worn; Functioning		
	Shroud	Slightly Worn; Functioning		
Bolt	Face	Slightly Worn; Functioning		
	Handle	Slightly Worn; Functioning		
	Stop	Slightly Worn; Not Functioning	Stop was sticking due to sticky residue.	
	Condition	Slightly Worn; Functioning		
Extractor	Cut Condition	Slightly Worn; Functioning		
	Ext/Eject Test	True]	
	Block Condition	Select	1	
Locking	Lug Condition	Like new; Functioning		
	Notch Condition	Select		
	Condition	Select	1	
Magazine	Box Condition	Like new; Functioning	Ī	
,	Exterior Condition	Slightly Worn; Functioning	some surface rust	
Overall	Stock Condition	Like new; Functioning		
	Fore End Condition	Select		
Receiver	Condition	Slightly Worn; Functioning	some rust near the port area	
	Bulged	False		_
	Description		Model 700]
Safety	Function	Like new; Functioning		
	Sub-Assembly	Non-ISS]	
Sear	Lift	Select	not measured]
	Notch	Like new; Functioning		_
		Condition	Abused; Functioning	Blocker adjusted so it is not returning the trigger under the sear
Pull		Select	3 1/4 lbs	
Altered	Trigger	True		_
Sub- Assembly		X-Mark Pro		

PS 09339

Address Information Custome: Flecerved From Return To: Flecerved From	Address Information Customer: Figure Received From Return To Circle Received From Name: KEVIN CONNER KEVIN CONNER Address 1:	Repair: Indiury Repair Number RE00148948 Verify Repair	Serial: G6536738 Model:700, Center inch bairel: Caliber: 7MM-REM-MAG-C Produced: 01/16/2007	DIV. TANK A STATE OF THE PARTY	6/2008 5.28.34 PM	
Address 2: PO-Box MOUNTAIN VIEW State: MO Zip Code:	Address 2: PO-Box MOUNTAIN VIEW State: MO Zip Code: 55548 Country US State: MO Zip Code: 55548 Country US FEL	Address Information Customer	© Received From	Return To:		
Contact / Condition Problems Estimate History / Status Shipping / Billing Date Code User ID Desc1 Shipping Hold Closed 8/8/2008 5:26:55 New brygidowwr Repair Added InterFace Hold 8/8/2008 5:28:34 PM 8/13/2008 7:17:5 Comment supyll Returned for special price repair Farts Received Repair Location ILN Return As Received Current Location Has been Approved Transfer Number 1/3 Shipping / Billing Shipping / Billing Current Status Shipping / Billing B/8/2008 5:26:55 New brygidowwr Repair Added Closed By8/2008 5:28:34 PM B/8/2008 5:28:34 PM	Contact / Condition Problems Estimate History / Status Shipping / Billing Date	Address 2: City: MOUNTAIN VIEW	PO Box	MOUNTAIN VIEW		
Repair Search Close Close	Repair Search Close Close	Date Code 8/8/2008 5:26:5E New 8/8/2008 5:28:34 Obsed	UserID Desc1 bygidowwy Repair Added bygidowwy Closed at Expedite	Shipping Hold Shipping Hold	Current Status Closed B/8/2008 5:28:34 PM biygidowwr Product Services Repair Location LIN Current Location	
		Repair <u>S</u> earch		<u> É</u> efres	h Close	



2601

July 30, 2009

To: Remington Arms
Attn: Arms Services
14 Hoefler Avenue
Ilion, NY 13357

From: Kevin Conner

8500 County Road 3940 Mountain View, MO 65548

Home: 417-934-1569 Cell: 417-247-0971

Home: 417-934-2291 ext. 233

Trigger Assembly
screw settings adjusted,
scope sever hole
assistant of broken
prece in hole
Repair if passible if
not offer new borneled
Action of & normal charges
and install new TA.

FLS 8/13/08

Dear Sirs:

Enclosed is my Remington Model 700 CDL, serial number G6636738, 7 MM REM MAG.

While hunting this past winter, I took my gun off safety and when I did the gun discharged. I would appreciate you checking this problem out for me. Also, when I was taking off the scope to prepare for shipping, I broke a screw off in the scope mount. I also ask that you tap that hole out for me.

If you need to contact me, I have enclosed my home, cell and work number.

Sincerely,

Kevin Conner

G6636738

148948

#2621

Date 8/16/07	
M KEVIN CONNER	
Address	

Add	ress			
Reg	. No. Clark	Account Forward	1	
1	REM 7mm CDL		710	00
2	(2) LEUP. 4.5x14	400EA.	1200	00
3	LEUA RINGS : BASE	5	45	00
4			1955	00
5		TAX	136	85
6			2091	85
7		K		
8		30		
9	, , , ,	7		
10				
17	X			
12	1			
73				
14	efficiency of the state of the			
75	7376=73			
35	Your Account States to Date - If Er	ror is Found,	Return at C	Dirce