

Remington Arms Co., Inc.
Product Service
Legal Case #:2129

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
140902	2/11/2008	2/12/2008	2/12/2008				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter		Paul	Bell	2 Rinehart Lane	Pottersville	NJ	07979		H 908-719-4304

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038	Could Not Duplicate Concern		
S	fired w/o pulling trigger	Concern:1025	Unexplained Discharge - No Mention of Safety Position	Unknown
C				

2/13/08-correspondence from repair-safety did not appear to work properly, trigger would fire without the bolt being pulled.lw

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl	DOM
Remington	CF/BA	700/3006 SPR	20000	6470782	WU	8/1/1971
Date Purchased	Where Purchased	Accessories	Original Owner			
	-AMES AMANN CORP PEARL RVR NY	SCOPE BASE	U			

CONCERN:WOULD FIRE WITHOUT TRIGGER BEING PULLED

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Replace TA under smp						
	Repair/Replacement Cost	Repair/Replacement Date				

2/13/08-quote sent to replace TA under smp.lw

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		2/12/2008
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4038	Could Not Duplicate Concern	TPA HAS A DRIED AND STICKY LUBRICATION RESIDUE
Barrel	Description		22" 3006 SPR
	Date Code		WU
	Bore Plugged	False	
	Bulged	False	

	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.011
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY/STICKY
	Pull	---Select---	5#
	Altered	False	
	Sub-Assembly	Other Remington	
Non-Remington Components	Description		SCOPE BASE

2129

Page I

1/25/08

To

REPAIR SERVICE
ARM.

5#
WU 8/91
"011"
22

Remington Arms Co. Inc.

14 ~~1400~~ Hoe Flen Ave could not duplicate concern
ILION N.Y. 13357 TRIG. ASSM. HAS A PARTIALLY
800-243-9700 DRIED + STICKY LUBRICATION
RESIDUE, CAUSING PARTS TO
WORK SLUGGISH. REPLACE TRIG,
CHECK OVER, CLEAN UNDER
BOLT LOCK PROGRAM RCR
\$20.00 + SHIP

FROM PAUL W. BELL
2 RINEHART LANE
POTTERSVILLE NY.

Quote

DAY 908-908-719-4304 - EVN. 908-439-2214

RETURNING FOR SERVICE

Remington - 30-06 -

MODEL 700

SER # 6470782

PURCHASE THE RIFLE approx 1967 AND HAVE USED
IT WITH OUT PROBLEMS UNTIL LAST DECEMBER.

- ① THE SAFETY DID NOT APPEAR TO WORK PROPERLY
- ② THE TRIGGER WOULD FIRE WITH OUT BEING PULLED
- ③ AT DEER CAMP. REMOVE BARREL AND RECEIVER
FROM STOCK

Page 11

3

NOTICED MARK- ON TRIGGER ACTION NOT
NOTICED BEFORE AND WHAT APPEARS TO BE
A BULGE IN THE RECEIVER.

THE LAST TIME THIS GUN WAS FIRED WAS IN
NAMIBIA. WITHOUT ANY PROBLEMS.

UPON RETURN TO THE US. I HAD A LOCAL
SPORTING STORE + GUN SMITH - CLEAN AND
REASSEMBLE THE RIFLE.

PLEASE ADVISE AS TO CONDITION OF THE RIFLE.
AND REPAIRS. MY E-MAIL AT WORK
IS bell@pgbank.com

THANK YOU

PAUL W. BELL

P/S

THE RIFLE APPEARS TO FIRE AFTER I WIPOD SOME
MATERIAL off of THE TRIGGER CASE.

Serial
Number:

6470782

Model: 700



RF00140907