

Remington Arms Co., Inc.
Product Service
Legal Case #:2031

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
140030	1/17/2008	1/18/2008	1/18/2008				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Pure Pennsylvania	Michael	Protz	Rt 11 Halstead Plaza	Hallstead	PA	18822		W 570-879-4981

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	fires on bolt closing	Concern:1008 Fired on Bolt Closing		
C				

1/23/08-correspondence from repair-upon closing the bolt the rifle fires without pulling the trigger.lw

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPR	20000	A6333551	OI	7/14/1976
Date Purchased	Where Purchased	Accessories	Original Owner			
	OUTDOOR SPTS HQ DAYTON OH	TWO PIECE SCOPE BASE	U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Replace TA under SMP						
	Repair/Replacement Cost	Repair/Replacement Date				

1/23/08-Quote sent to replace TA under smp.lw

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/18/2008
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY

Cause	4015	Improper Maintenance	TRIG ASSM DIRTY AND STICKY SEAR CAM BINDING
Barrel	Description		22" 3006 SPR
	Date Code		OI
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.009
	Notch	Slightly Worn; Functioning	STICKY
	Tests	Test Fired	False
Feeding Test		False	
	Condition	Slightly Worn; Functioning	DIRTY/STICKY

Trigger	Pull	---Select---	6#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE SCOPE BASE

Inbox - Microsoft Out...
Arms Services Repair
PS Hold Guns AS
Current Cases - Micro...
11:28 AM

RECEIVED
JAN 22 2008
BY: *[Signature]*

... REM MOD 700 30-06

S/N A6333551

PROBLEM

!!!

2031

1/10/08

OT 7/76

.009

6#

22"

UPON CLOSING THE BOLT THE
RIFLE FIRES WITHOUT PULLING THE
TRIGGER!

Michael Protz Jr.

HALLSTEAD ELECTRONICS

&

SPORTING GOODS

MICHAEL PROTZ, JR., OWNER

P.O. BOX 40 • HALLSTEAD PLAZA

HALLSTEAD, PA 18822

FAX & PHONE: 570-879-4981 OR 570-879-2043

AT&T WIRELESS COMM.

Serial
Number:

A6333551

Model: 700



RE00140030

could not duplicate concern
Trig. assm. very dirty + sticky,
causing parts to bind.
replace TPA, check over, clean
under bolt lock program
ROR \$20.00 + S + H.

Quote