Remington Arms Co., Inc. **Product Service** Legal Case #:3042

Case Information

Date Closed Incident Date Obsolete RE# Date Opened(PS) Pre Lit Lit **Date Opened** 1/8/2009 158178 1/7/2009 1/8/2009

Customer Information

First Last Name Street City State Zip Age Contact **Business** Type Name 314 Pine Hwy 19 W 573-775-Valjons Southside General Store Valjons Reporter Steelville MO 65565 LLC Southsi South 2462

Incident Information

Codes Repair Est. Medical Treatment Medical Status Claims

ΡI

PD Cause: 4015 Improper Maintenance Unknown S Concern:1007 Fired on Safe Release firearm fires when setting the safety

1/13/09 According to paperwork sent with rifle, it fires when setting the safety.cm

Firearm Information

SKU **DOM** Model/Ga. Serial Bbl. Mfg. Type 27476 8/22/1997 700/270 WIN E6392070 WR Remington CF/BA **Date Purchased** Where Purchased Accessories **Original Owner** U

WAL-MART WAREHOUSE #3R

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Reim. Date Cash Date Cash Settlement Release of Claims **Release Date** Reimbursement Settlement APV APV

repair at 1/2 normal charges as goodwill gesture


Repair/Replacement Repair/Replacement Cost Date 62.39 1/13/2009

1/13/09 Quoting repair at 1/2 normal charges as gesture of good will.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/8/2009
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	
Barrel	Description		22" 270 WIN
	Date Code		WR
	Bore Plugged	False	
	Bulged	False	
	Fired	False	· ·
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	·
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Functioning	METAL RUSTY/DIRTY
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.012
	Notch	Like new; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	TRIG AND PIN RUSTY TRIG BINDING
	Pull	Select	8#
	Altered	False	
	Sub-Assembly	M/700 Non-Bolt Lock	

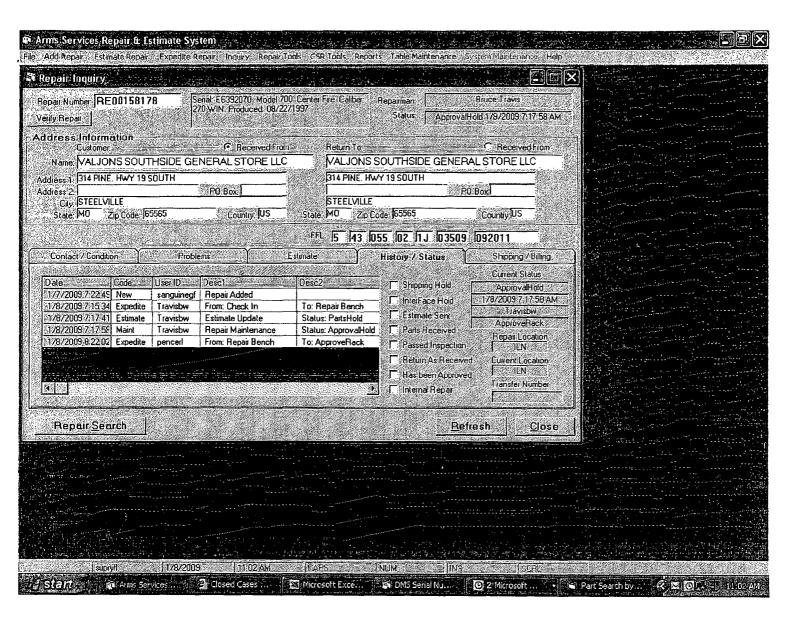

Quoting repair at 2 normal changes a gesture of goodwill FCS 1/8/2008 3047

221' WRX/97 8#



Model:

700



Fire Arm Fires Tuhen Setting the SARETY.

> 10 LBS 1 OF 1 SHP WT: 10 LBS DATE: 12 DEC 2008

SOUTHSIDE GENERAL (573) 775-2462 314 PINE ST STEELVILLE MO 65565

SHIP REMMINGTON ARMS TO 14 HOEFLER AVE

ILION NY 13357-1888

Improper maintenance
Trig. + Trig. PIN RUSTED AND
CAUSING TRIQ. TO BIND.
ReplaceTPA, checkonen clean
AT 1/2 Normal change Good-will
Gesture.
Quote