Remington Arms Co., Inc. Product Service Legal Case #:4236

Case Information

RE# Date Opened Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete
185121 1/7/2010 1/13/2010 1/13/2010 X

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact H 707-274-9746 Incident James C. McDonald 6806 Frontage Rd. Lucerne CA 95458 E mcdonald.craig@ymail.com

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

PD Cause:4015 Improper Maintenance S Concern:1008 Fired on Bolt Closing

Unknown

C Fired on bolt closing

Customer reported on our repair form - Cartridge fired when he loaded & shut the bolt. Sometimes it will not cock when closing the bolt. Fired once when he clicked the Safety off. dmf

Firearm Information

Mfg. Type
Remington CF/BA

Date Purchased Where Purchased

Model/Ga.SKUSerialBbl.DOMXP100/221 FB*1848LK2/1/1963AccessoriesOriginal Owner

Accessories Original O
SCOPE BASE N

CONCERN:FBC

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/XP100/CF/BA

Settlement

Release of Claims

Release Date

Reimbursement

Cash Settlement Reim. Date Cash Date APV APV

Per Ilion - Repair @ 1/2 normal cost

> Repair/Replacement Cost

Repair/Replacement Date

1/15/10: Per Fred S. - Trigger is contaminated with a partially dried & sticky lubrication residue. Will check over completely, lube, check function & safety at 1/2 normal cost. dmf

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		1/13/2010
Examination	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	
Barrel	Description		10.5" 221 FB VT
	Date Code		LK
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		_
	Muzzle/Crown Condition	Slightly Worn; Functioning	

i,

	Transition of the second	CI 14 W F C	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Worn; Functioning	SOME LIGHT UPSET FROM LEAKING PRIMERS
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	WORKS SLUGGISH
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
G - G-4	Description		STANDARD M/XP100 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Lift	Select	.010
Sear	Notch	Slightly Worn; Functioning	O/S DOUBLE SEAR
		Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Functioning	DIRTY STICKY WORKS SLUGGISH
	Pull	Select	1.5#
Trigger	Altered	False	
	Sub-Assembly	Other Remington	
Non-Remington Components	{\ <u></u>		SCOPE BASE

Remington.

Repair Form

(NOTE: Please print and complete this form, and then include it with your firearm.)

Model Number: XP-100 Serial Number: 1848

Name: James C. McDonald Date of Purchase: Used APROX ZOON

Address (no PO Boxes): 6806 Frontage Road

City: Lucerne State: Calif, Zip: 9545,8

Phone (Daytime): 707-274-9746 Fax:

E-mail Address: mcdonald.craig@ymail.com

Please describe your problem: Cartridge Fired when I loaded + Shut bolt. Sometimes went cock when closing bolt.

Fired once when I clicked the safety off

Additional Information: (Ammo type, brand, handload specifications, etc.)

Remination 50 gr pointed soft point

NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time.

WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.

Trazim bafara sonding it.

1848

Model: XP-100



RE00185121

nage in shipping and handling. Preferably, returned.)
ss or damage.

Remington is not responsible for urchase insurance from your carrier.

Thing is contaminated with a partially dried + sticky
Lubrication posidue. Will check
Over completely, clean + properly
Lube, Check Function + safety at
1/2 cost of Test + cleaning changes.

Quote

10/20/2009 4:21 PM

1 of 1

1. KZ/63

010

Arms Services Repair &				
File Acd Repair Estimate Repair 1	Expédite Repair (Inquiry (Repair Tools (CSR	Tools Reports Table Maintenance Sys	tem Mäintenance: Help	
Repar Number, RE00185121 Verify Repair Address Information	2/1 FIREBALL	Slatus ApprovalHold 1/13/2010 8:54:06 AM		
Customer: Name: JAMES McDONALD Address 1: 5806 FRONTAGE ROAD	Received From Return Γα: JAMES McD 6806 FRONTAG	and the state of the factor of a first state in the same limited by the limited and before the same and the same state of the same state o		
Addiess 2 Chit LUCERNE State CA Zip Code; 195458	PO Box LUCERNE	PO 8 ox. er. 95458 Country: US		
Contact / Condition Pro	FFL	history / Status Shaping / Billing		
1/7/2010 11:224 Expedite v 1/7/2010 12:05:0 EmailSent A 1/7/2010 12:05:0 EmailVerified A	set ID Desc1 alentos From Check In mmEmail Repair Received umEmail Receipt encer From Product Services	Current Status Shipping Hold Approval-hold InterFace Hold 1/13/2010 8:54:06 AM Estimate Sent ApproveRack Patts Received		
1/13/2010 6:18:5 Maint T 1/13/2010 6:54:0 Estimate T 1/13/2010 8:54:5 Estimate T	iavisbw Repair Maintenance l'avisbw Estimate Update l'avisbw Estimate Update encer From Repair Bench	Pairs received Repair Location Passed Inspection LIN Return As Received Current Location Has been Approved LIN Internal Repair Transfer Number		
Repair Search		Refresh Close		
			化分类型系统 图像型数据数据	
6 V		IOM PERMIT		/@0?(003) 350
33 start © teor. Mores	ulti			S CALLY S (SIGNAL) SECTION

