Remington Arms Co., Inc. **Product Service** Legal Case #:3850

Case Information

RE# **Date Opened** Date Opened(PS) Pre Lit Lit Obsolete **Date Closed Incident Date** 177371 10/9/2009 10/12/2009 10/12/2009

Customer Information

Business First Name Last Name Type Street Contact City State Zip Age

H 304-463-4500 Michael E. 141 Thomas Ave. Davis WV 26260 Reporter Supak E mesupak@gmail.com

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

ΡI

PD Cause:4015 Improper Maintenance

Unknown Gun will fire with Safety Concern:1028 Fired With Safe ON

C

Customer reported: Occaionally, when safety is disengaged - rifle will not fire, but fires when safety is moved back to the Safe position. dmf

Firearm Information

Mfg. Model/Ga. **SKU Type** Serial Bbl. **DOM**

CF/BA 600/243 WIN Remington 96747 EP 10/1/1967

Date Purchased Where Purchased Accessories **Original Owner**

SCOPE BASE U

CONCERN: FIRES WHEN SAFETY MOVED ON

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/600/CF/BA

Reim. Date Cash Date Cash Release of Claims **Release Date** Reimbursement Settlement Settlement APV APV

Repair at no charge

> Repair/Replacement Repair/Replacement Cost Date

10/13/2009

\$48.09

10/13/09: Per Fred S. - Could not duplicate concern. Trigger is dirty & sluggish. Replace trigger assemb. at n/c under recall. dmf

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		10/12/2009
Examination	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=3850&Type=Case

10/13/2009

Cause	4015	Improper Maintenance	TPA HAS NOT BEEN YPDATED
	Description		18.5" 243 WIN
	Date Code		EP
	Bore Plugged	False	
Barrel	Bulged	False	
Darrer	Fired	False	
	Fired while Obstructe	d	
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	<u> </u>
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/600 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Lift	Select	.005
Sear	Notch	Slightly Worn; Functioning	SLUGGISH
	Tests	Test Fired	False
Feeding Test	1000	False	
	Condition	Slightly Worn; Functioning	DIRTY/SLUGGISH
Trigger	Pull	Select	7.5#
50	Altered	False	
	Sub-Assembly	Other Remington	7

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=3850&Type=Case

10/13/2009

Non-Remington
Components

SCOPE BASE





T.D

General Repair Form

Back to Repair Services

Model Number: MODEL 600	Serial Number: 96747
Name: Michael E. Supak	Date of Purchase:
Address (no PO Boxes): 141 Thomas Ave.	
City: Davis	State: WV Zip: 26260
Phone (Daytime): 304-463-4500	Fax:
E-mail Address: mesupak@gmail.com	AND ADMINISTRATION OF THE PROPERTY OF THE PROP
Please describe your problem:	
15 moved back to	re, but fires whom safety the safe position.
15 moved back to	the safe position.
15 moved back to 500 characters left	the safe position. pair Center for services provided and estimated repair time.
500 characters left NOTE: Prior to shipping your firearm, contact the Re WARNING: DO NOT SEND LIVE OR SPENT SHE THIS IS A VIOLATION OF FEDERAL LAW. IF YOU	the sate position.

96747
Model: 600
RE00177371

Visit Our Other Websites

Other Sites

could not duplicate concern.
Triq. 15 DIRTY + sluggish. Replace
TPA UNDER RECIAILAT N/C

230145

9/17/2009 12:01 PM

