

Remington Arms Co., Inc.
Product Service
Legal Case #:3551

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
169528	6/17/2009	6/18/2009	6/18/2009				X

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter		Lamar	Liddle	1434 Bayshore Ct	Gulf Breeze	FL	32563		H 850-932-1595

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	Fired when bolt was closed quickly	Cause:4006 Altered Adjustments or Components Concern:1008 Fired on Bolt Closing		Unknown
C				

PI

PD

S Fired when bolt was closed quickly

Cause:4006 Altered Adjustments or Components

Concern:1008 Fired on Bolt Closing

Unknown

C

6/22/09-Rifle returned several years ago for SMP. Rarely used, gun discharged when bolt was closed quickly. Wants it fixed. No mention of damage or injury.lw

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	660/308 WIN		6224839	AS	3/1/1969
Date Purchased	Where Purchased	Accessories	Original Owner			
		SCOPE BASE,STUDS	U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/660/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Replce TPA under SMP						
	Repair/Replacement Cost	Repair/Replacement Date				

6/22/09-Replacing TPA under SMP program for \$20.lw

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		6/18/2009
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4006	Altered Adjustments or Components	POOR MAINTENENCE TRIGGER HAS BEEN UPDATED
Barrel	Description		20" 308 WIN
	Date Code		AS
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/660 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.009
	Notch	Like new; Not Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	SEAR BINDING TO SIDEPLATES WILL FOLLOW DOWN
	Pull	---Select---	2#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	Other Remington	
Non-Remington Components	Description		SCOPE BASE,STUDS

3551
AS 3/69
2#
20"
009

LAMAR M. LIDDLE
1434 BAYSHORE COURT
GULF BREEZE, FL 32563
850-932-1595

June 4, 2009

Remington Arms Company
14 Hoefler Avenue
Ilion, NY 13357

Attention: BL Safety Program

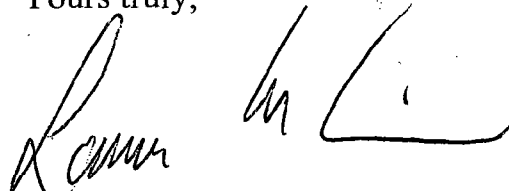
Gentlemen:

Enclosed please find my Remington Model 660, Serial # 6224839. This rifle was returned to you several years ago to have the trigger mechanism replaced per your 1979 Safety Recall Program. Because I reserve this rifle for my guests, it has had less than a box of shells fired through it. Recently I discovered it would discharge when the bolt was closed quickly. I understand from reading on your Website that this is "fixable". Previous problem that you fixed was that it discharged when putting the safety "on".

I appreciate your help in correcting this matter. Please call me if you have any questions.

Thank you.

Yours truly,


Lamar M. Liddle

Trig. set screws altered, Trig.
Assm. Dirty/sticky, gear binding
to side plates. Replace TPA under
Boltlock program for \$20.00 + SH.
Quote

Serial
Number:

6224839

Model: 660



RE00169528