Remington Arms Co., Inc. Product Service Legal Case #:3785

( age	Inform	nati∩r

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Obsolete 175246 9/16/2009 9/17/2009 9/17/2009

Customer Information

Business First Name Last Name Contact Type City Street State Zip Age H 425-280-1204 Incident Robert Mast 6203 223rd Pl SW Mountlake Terrace WA 98043 E rmast98@yahoo.com

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

PD Cause:4006 Altered Adjustments or Components

Unknown

S fires on safety release Concern:1007 Fired on Safe Release

9/21/09 Per note with rifle, he sent it for the BLSM program. He notates that the rifle may fire without pulling the trigger; if safety is on and trigger is pulled then safety is turned off, it will sometimes fire.cm

Firearm Information

Mfg. Type Model/Ga. **SKU** Serial Bbl. DOM CF/BA 722/300 SAV 1/1/1952 Remington 224483 BYY

**Date Purchased** Where Purchased Accessories **Original Owner SLING** 

U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/722/CF/BA

Reim. Date Cash Date Cash Release of Claims Release Date Settlement Reimbursement Settlement APV APV

replace TPA under BLSM program price

Repair/Replacement Repair/Replacement Cost Date

43.12 9/21/2009

9/21/09 Trigger set screws altered. Will follow down. Replace TPA, check over, clean under BLSM program price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		9/17/2009
Examination	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4006	Altered Adjustments or Components	
	Description		24" 300 SAV
	Date Code		BYY
	Bore Plugged	False	
Barrel	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	1
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDING
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/722 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Lift	Select	.010
Sear	Notch	Slightly Worn; Functioning	O/S DOUBLE
	Tests	Test Fired	False
Feeding Test	1 6515	False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	Select	1.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	Other Remington	
Non-Remington Components	Description		SLING

Repair Inquiry	Serial: 224483 Model 722 Center Fire with	24 Repairman Bruce	Travis			in the state of th
nily Repair	inch barrel Caliber: 300 SAV.	Status: ApprovalHold 9/17				
Customer: Name: ROBERT MAST  Utiess 1: 6203 223 RD. PL. S.W.	ROE	mTo: C   F BERT MAST 3223 RD. PL. S.W. PO Box!	Received From			
City: MOUNTLAKE TERRACE Stale: IWA Zip Code: 198043	MOU	INTLAKE TERRACE	ntry:US	i i je i s		
Contact / Condition Pro	FFL:	History / Status S	hipping / Billing	计算量		
Date         Code         Usei           9/16/2009 12:05         EmailSent         ArmE           9/16/2009 12:05         EmailVerified         ArmE           9/16/2009 2:43:2         Expedite         penc           9/17/2009 10:06         Maint         Trave           9/17/2009 11:41:         Estimate         Trev           9/17/2009 11:41:         Approval-loid         Trave           9/17/2009 11:42:         Approval-loid         Syste           4	mail Repair Received RMASTS mail Receipt RMASTS RMASTS ettl From: Check In To: Repa sbw Repair Mantenance Status: R sbw Estimate Update Status: P status: Approval-Hold sbw Repair Maintenance Status: A	Shipping Hold   100	unent Status ApprovalHold ZO09 11:41:26 AM Travistow ApproveRack lepair Location ILN unent Location ILN transfer Number			
Repair <u>S</u> earch		<u>R</u> efresh	Close			400
e Britania Britania						
Bearing I make a second and the seco		Lincoln (1912)				distant 1±0
						of contracts
supryfl {9/17/2	009 {1:43 PM CAPS	NUM = √ENA	TITA .			
start 💮 🗹 📖 Amisa		olexer decise of the second			** ** ** *** *** **** **** ***** ***** ****	Dept. K. Left
						7
					20.53	
					13	
					20	
		nect	ZIWIZT:		<i>?5</i>	
		NECI N cep :	ZIVIZ 2 1 2009		35 12 82.53 39.41	





BY1. 1/5° 15° 24"

## General Repair Form

Back to Repair Services

NOTE: Please complete and print this form, and then include it with your firearm

Model Number: 722 (300 SAVAGE)	Serial Number: 224483			
Name: ROBERT MAST	Date of Purchase: N/A			
Address (no PO Boxes): 6203 223RD PL SW				
City: MOUNTLAKE TERRACE	State: WA Zip: 98043			
Phone (Daytime): 425-280-1204	Fax:			
E-mail Address: rmast98@yahoo.com				
Please describe your problem:				
BOLT LOCK SAFETY MODIFICATION				
ALSO RIFLE MAY FIRE, IF SAFETY IS ON AND TRIGGER IS PULLED THEN SAFETY IS TURN OFF, IT SOMETIMES FIRES,				
AND BOLT GO PAST STOP WHEN RECHAMBERING				
	*			
320 characters left				
NOTE: Prior to shipping your firearm, contact the Repair Center	for services provided and estimated repair time.			
(1) WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.				
Record the serial number of your firearm before sending it.  Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)  Remove all accessories from your firearm to prevent loss or damage.  Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.				

224483

Model: 722

MILLIANS RE00175246

TRIG. Set SCIEWS ALTERED.
WILL FOLLOW DOWN. Hybrice
TRA check over eleAN,
under Bolt Locic Other Sites
Imagerin Ron to 20.00 +5 MH.

Quote

general repair form.asp

9/12/2009