## Remington Arms Co., Inc. Product Service Legal Case #:4720

Case Information

RE# Date Opened Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete 9/8/2010 9/8/2010 201818 9/1/2010

Customer Information

Type **Business** First Name Last Name Street City State Zip Contact 2573 Wilderness Rd. Reporter Orville D. Dehart Bland 24315 H n/a

Incident Information

Claims Codes Repair Est. **Medical Treatment Medical Status** 

PΙ

PD Cause: 4015 Improper Maintenance S Concern:1008 Fired on Bolt Closing

Unknown

Bbl.

**DOM** 

12/18/2001 9:32:23 AM

C FBC & FSR

Customer did not send correspondence w/gun. A CSR spoke w/customer & he stated that the rifle would fire on bolt closing & when switching safety. dmf

Firearm Information

Model/Ga. SKU Mfg. Type Remington CF/BA 700/7MM RUM 26269 G6207707 XV

Where Purchased Original Owner Accessories **Date Purchased** 

WILLIAMS SHOOTERS SUPPLY U

CONCERN:FSR,FBC

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

·Remington/700/CF/BA

Reim. Date Cash Date Cash Release of Claims Release Date Settlement Reimbursement Settlement APV APV

Per Ilion - Repair @ n/c goodwill gesture

> Repair/Replacement Repair/Replacement Date Cost

\$79.73 9/9/2010

9/9/10: Per Fred S. - Action is very dirty. Will follow down. Check over completely. Replace TPA, clean action, function test @ n/c goodwill gesture. dmf

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		9/8/2010
Examination	Product Type		RF
	Action Type		Α
	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	ACTION/TPA VERY DIRTY
	Description		26" 7MM RUM
	Date Code		XV
	Bore Plugged	False	
Barrel	Bulged	False	
	Fired	False	
1 !	Fired while Obstructed		- -

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=4720&Type=Case

9/9/2010

	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Not Functioning	
Overall	Stock Condition	Worn; Functioning	
	Fore End Condition	Select	]
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
	Description		STANDARD M/700 SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	ISS	
	Lift	Select	N/A
Sear	Notch	Like new; Not Functioning	VERY DIRTY
		Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Not Functioning	TRIGGER VERY DIRTY,PARTS WORK SLUGGISH,POSSIBLE DEBRI BETWEEN TRIG AND CONNECTOR
Trigger	Pull	Select	1#
	Altered	False	
	Sub-Assembly	M/700 Non-Bolt Lock	

Add Repair	Estimate Rep	air Expedite F	Repair In	nquiry Rep	pair Tools C	SR Tools	Reports	Table Maintenance	System				
									. , .				·
			•		10.20	ecsakaanaa		A. Theorem					
		**			1 4 6 1	1	4	2324					
				-13	5 max =	C. C				-tan		2.1	
			45	4.4					(A)	44	Mujiri		
			F. 77		فيحد	and the							
					CHEST				<b>*</b>	877	हों हो।		
		Repair Ingl	TITY\			* **							
	A P	epar Number: RI	E0020181	8 Seriat	G6207707, Mod TRA MAG Produ	el 700 Cente iced 12/18/2	r Fre Caliber 2001	7 » Reparman C	hailes Swanson			A. C. C.	
		Verily Repair						Status F	leparing 9/8/2010 9	140:06 AM			
		ADDRESS INFORM	ATION :	\$-32. A.		Received fr		unTo		<u> </u>	77	4.5	
		Name: IOR	A	HART		neceived ii	50 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	ILLE D. DEHART	38385 V 3VA	leceived from		, Ask	
		Address 1. 257					30 miles	WILDERNESS RD.		1000000			
f(i)		Address 2			PO Box				PO Box:				
6-3		City BL/ State VA	AND A SECURITY OF THE PARTY OF	e 24315	Country. JU	<u>ر</u> الأراث	BLAI VA	NO Zip Code: 24315	Country: US				
		South State	ZPC	10 10 10 10 10 10 10 10 10 10 10 10 10 1	Course to			ZD 500E 124313	Couraly. 103				
				, Clark (i 45 Samuel de Albe	ne alum tribling all	, FFL							
		antact / Concition	Problems	Estimate: Hist	iony/status  Sh	ipping / Billing	<b>)</b>			Status	A	ing	
		Date 1999	Code	User ID	Desc1		774 . 14	Shipping Hold	A Re	paring	* 186	(3)	
	38	9/7/2010 11:3	Maint	swansonch	Estimate Upd Repair Mainte		Estimating Estimating	▼ Estimate Seni	Swe	9:40:06 AM Insonch			
		9/8/2010 9:39	Estimate	swansonch			PartsHold	Parls Received	Darate	allery Location			
		9/8/2010 9:40	Repairing	System	Immediate SA		. Iĝ	Passed Inspection Return as Receive		ILN Location			
		9/8/2010 10:3	Estimate	swansonch			Repairing	Has Been Approv	ed 💮 💮	ILN 2		J.	
. 1	ile si	9/8/201012:3	Expedite	pencerl	From Repair	Be To Gal	lety [1]	Internal Repair	- I rensie	i Number	7.75	130	P. Contraction of the Contractio
		estare en		* Y . X . Y	8-10/2 <b>1</b> ,000	( ) ( ) ( ) ( ) ( ) ( ) ( ) ( ) ( ) ( )	DA 91.4			771 F. 152			
		Repair Searc	<u> </u>		A 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4				Refres	h Clo	88		
		25 (A)			16.7	(N)				(3.0, 4.5. ))(vii.2,)			
			Filling				122		and the second	week.		*	
				-					, malika		Carlotte.		41.3
	100	**			100	Same and the same a				49.95			
		,		1	131					10 200-17			
				•			Waysa,			a Bar		. *	
•								· · · · · · · · · · · · · · · · · · ·			N. 1.		
												-	

	ZC	[2		VI	
Щ	逗© SEP	0	9	2010	
В		· <b></b> .			

Repair Number: RE00201818  Verity Repair  Address Information  Customer  Name: ORVILLE D. DEHART	Serial GG207707 Model 7 MM ULTRA MAG Produ Received Fro	ced:12/18/2001 Si	atus Approval-Hold 9/1/201	AND THE PROPERTY OF THE PROPER	
Address 1 2573 WILDERNESS RD.	∯>PO Box∫	2573 WILDERNESS BLAND State VA Zip Code [24]	RD:	US .	
Contect / Condition Problems Reported Cdde Desc M114 NOCORRESPONDENCE Problems Found Cdde Desc M114 NOCORRESPONDENCE	Problems  Fepai No  Awdan  Corresp  State  A de la cor	E stimate Historia	man's Comments	ang / Biling ()	
Repair Search :			<u>Refresh</u>	Close	



Will Follow down. Action Very dirty. check over completely. Replace TPA, clean action, function Test At M/C

#230145