## Remington Arms Co., Inc. Product Service Legal Case #:4943

Case Information

RE# Date Opened Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete 208954 11/2/2010 11/3/2010 11/17/2010

**Customer Information** 

First Name Last Name Street Zip Contact Type **Business** City State Age William 904 Maxine Ave. C 417-229-1223 Incident Ludwig Crane 65633

Incident Information

Claims Codes Repair Medical Medical Status

ΡI

PD Shot hole in truck Cause:4006 Altered Adjustments or Components

Concern: 1025 Unexplained Discharge - No Mention of Unknown

Unexplained Concern: 1023 Safety Position

Discharge

Customer wrote in a note with the gun - "Please inspect and make the gun safe. It went off and shot the floor board of my truck. Please install x-mark pro trigger". df

Firearm Information

 Mfg.
 Type
 Model/Ga.
 SKU
 Serial
 Bbl.
 DOM

 Remington
 CF/BA
 700/3006 SPR
 n/a
 6223494
 AS
 3/1/1969

Date Purchased Where Purchased Accessories Original Owner

WYETH CO ST JOE MO U

CONCERN: WENT OFF, SHOT THUR FLOOR OF TRUCK

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Settlement Release Date Reimbursement Release Date Reimbursement Release Date Reimbursement Release Date APV APV

Quote to repair under BLM program

Repair/Replacement Cost Repair/Replacement Date

\$60.23 11/17/2010

11/15/10: I called cust. He was not home. Left msg w/wife for cust. to contact me. I will have factory quote to repair for \$37 under BLM program. df 11/16/10: Cust. called. We went over report. He is ok w/quote to repair. I emailed factory to prepare quote. df 11/17/10: Factory did repair & is shipping out COD. I called cust. & he is ok with that. df


Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment	
Examination	Examiner		B.TRAVIS	
	Exam Date		11/3/2010	
	Product Type		RF	Ī

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=4943&Type=Case

11/17/2010

ŀ	A -4: T	i	
	Action Type		IA
	Assigned To	<u> </u>	F.SUPR Y
Cause	4006	Altered Adjustments or Components	POOR MAINTENENCE
	Description		22" 30-06 SPR
	Date Code		AS
	Bore Plugged	False	
Barrel	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	DIRTY/STICKY
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	WORKS SLUGGISH
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Worn; Functioning	
Overall	Stock Condition	Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description	]	STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	.004
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning	VERY DIRTY WITH A DRIED AND STICKY LUBRICATION RESIDUE
	Pull	Select	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	

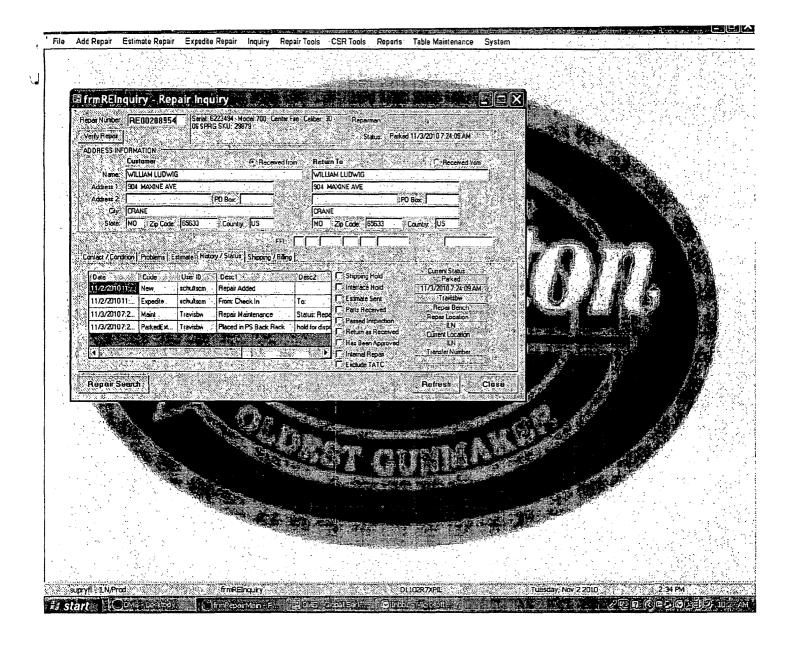

	ECEI' NOV - 4			VE	
Ŋ	ИОИ	-	<u>_</u>	2010	
В	Y:				

X-mark Model: 100 BOC 30-06 Mr. William E. Ludwig 904 Maxine Ave. Crane, MO 65633