Unknown

## Remington Arms Co., Inc. Product Service Legal Case #:5470

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete 12/20/2010 12/20/2010 215375 12/18/2010

**Customer Information** 

Type Business First Name Last Name Street City State Zip Contact Age H 570-785-2092 John 702 Ash St Vandling Incident Mayers PA 18421 E ramsey@nep.net

Incident Information

Medical Repair Medical Codes Claims Est. Treatment Status

Ρſ

PD Cause:4038 Could Not Duplicate Concern

Fires when loading and S unloading

Unexplained Discharge - No Mention of Concern:1025

Safety Position

C

1/5/1 I Per letter with rifle, this rifle had been sent to the factory previously for the same problem. it has happened since being returned. It has a history of firing on it's own during loading and unloading.cm

Firearm Information

Model/Ga. SKU **DOM** Mfg. Type Serial Bbl. CF/BA 700/3006 Remington A6727744 LV 2/6/1979 n/a **Date Purchased** Where Purchased Accessories **Original Owner** 

M/W DIST NITRO WV

U

Ammunition Information - None Defined Other Products Information - None Defined Settlement

## Remington/700/CF/BA

Cash Cash Reim. Settlement Release of Claims Release Date Reimbursement Date Settlement Date APV **APV** 

Per Ilion, replace trigger under BLSM program no charge as goodwill

> Repair/Replacement Repair/Replacement Cost

Date

59.40

1/5/2011

1/5/11 Per Ilion, install new trigger assmunder the bolt lock modification at no chaarge since we repaired this previously. Gesture of goodwill. Already shipped back to customer.cm


Examination[Remington/CF/BA]

 
Part	Sub-Part	Code	Comment
	Examiner	]	supry
į	Exam Date		12/20/2010
Examination	Product Type		RF
	Action Type		A_
	Assigned To	]	supry 12/20/2010 RF A Nagle
Cause		Could Not Duplicate Concern	Sticky residue and debris found on TA
	Description		24 inch Model 700
	Date Code		LV
	Bore Plugged	False	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=5470&Type=Case

1/5/2011

lı		15	ត់	
Barrel	Bulged	False	1	
	Fired	False	]	
	Fired while Obstructed		_	
	Muzzle/Crown Condition	Worn; Functioning		
Bolt	Firing Pin	Slightly Worn; Functioning		
	Shroud	Slightly Worn; Functioning		
	Face	Slightly Worn; Functioning		
	Handle	Slightly Worn; Functioning		
	Stop	Slightly Worn; Functioning		
	Condition	Worn; Functioning	]	
Extractor	Cut Condition	Slightly Worn; Functioning		
	Ext/Eject Test	False		
	Block Condition	Select	]	
Locking	Lug Condition	Slightly Worn; Functioning		
	Notch Condition	Select	]	
	Condition	Select		
Magazine	Box Condition	Slightly Worn; Functioning		
	Exterior Condition	Slightly Worn; Functioning		
Overall	Stock Condition	Slightly Worn; Functioning		
	Fore End Condition	Select	]	
Receiver	Condition	Slightly Worn; Functioning	·	
	Bulged	False	]	
Safety	Description	]	Model 700 Bolt Lock	
	Function	Slightly Worn; Functioning		
Sear	Lift	Select	not measured	
	Notch	Slightly Worn; Functioning		
		Condition	Abused; Functioning	Housing coated with sticky residue and debris
Pull	Trigger	Select	6.5 lbs	
Altered		False		
Sub-Assembly		M/700 Bolt Lock		_
Non-Remington Components	Description		One piece scope base and two bottom portions of of the ring set	

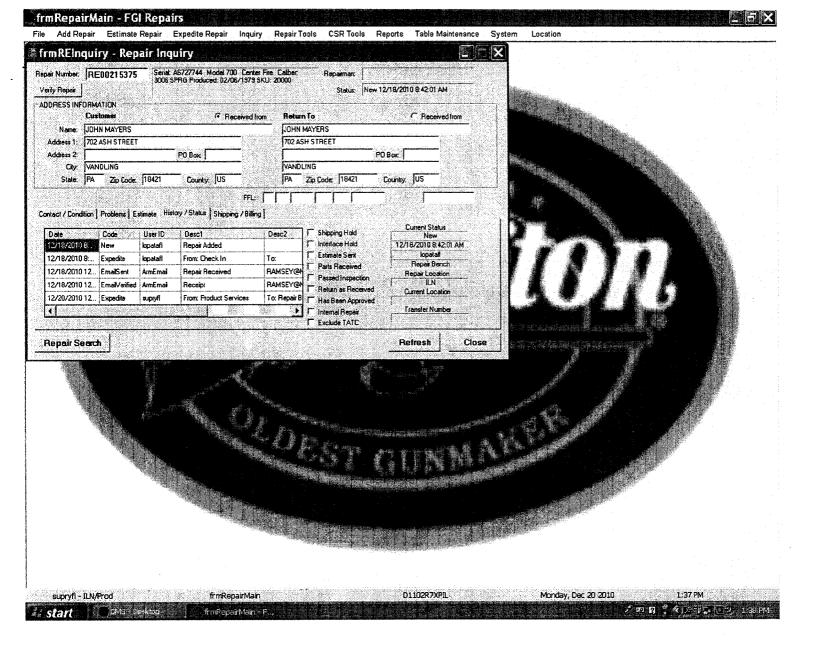



12/10/10

JOHN MAYERS 702 ASH ST. VAUDLING, PA 18421

> 570-785-2092 RAMSEY @ NEP. NET.

BA6727744

Model: **700** 

RE00215375

6,5 165

LV= 2/1979 Install New TA under the Bott Lock modification This GAN (REMINGTON 700 A4727744) HASA HISTORY

OF FIRTHE ON ITS OWN DURING LUDDING & UNLOADING. IT WAS RETURNED TO THE FACTORY PREVIOUSLYS SINCE THEN IT HAS HAPPENED REAINS IT IS MY UNDERSTANDIAL THAT A HIT CRISTS TO CORRECT THIS PROBLEW. PLEASE IUSALL , T.

Jahn Mayers

20.40 12.

125

WHEN YOU KNOW THE GOST SEND ME AN E-MAIL AND TILL Send you A check OR SIVE YOU A CROCKY CARD NUMBER.