Remington Arms Co., Inc. Product Service Legal Case #:4695

Case	Inform	ation

Date Closed RE# **Date Opened** Date Opened(PS) **Incident Date** Pre Lit Lit Obsolete 8/25/2010 201218 8/24/2010 8/25/2010

Customer Information

Business First Name **Last Name** Street City Contact Zip Age Type State H 970-222-3476 1902 Lookout Ln Fort Collins CO 80526 Incident Joel Powell E jpowell61@gmail.com

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

PD has fired when taking safety

Cause: 4006 Altered Adjustments or Components

Concern: 1007 Fired on Safe Release

Unknown

C

8/27/10 Per note with rifle, Powell wanted to send the gun in for the Bolt Lock Safety Modification. The gun has discharged once when taking the safety off to open the bolt.cm

Firearm Information

Mfg. Remington

Type CF/BA

Model/Ga. 700/308 WIN

SKU 20000

Serial 141458 Bbl. DOM 3/1/1965 AM

Date Purchased Where Purchased Accessories **Original Owner** U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date

Reimbursement

Cash Reim. Settlement Date APV Cash Date APV

Per Ilion, replace TPA, check, clean under BLSM price of \$20 + S&H

Repair/Replacement Repair/Replacement

Cost

Date

45.23

8/27/2010

8/27/10 Per Ilion, safety not working properly, it is not raising sear properly. Replace TPA, check over, clean under bolt lock program for \$20 + S&H.cm


Examination[Remington/CF/BA]

Comment Sub-Part Code Part **B.TRAVIS** Examiner Exam Date 8/25/2010 RF Examination Product Type Action Type Assigned To F.SUPRY Altered Adjustments or Components Cause 4006 22" 308 WIN Description Date Code AM Barrel False Bore Plugged Bulged False

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=4695&Type=Case

8/31/2010

	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Slightly Worn; Not Functioning	
·	Lift	Select	.001
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	Tesis	False	
Trigger	Condition	Slightly Worn; Functioning	SAFETY NOT WORKING
	Pull	Select	2.5#
	Altered	True	TRIG PULL ALTERED
	Sub-Assembly	M/700 Bolt Lock	

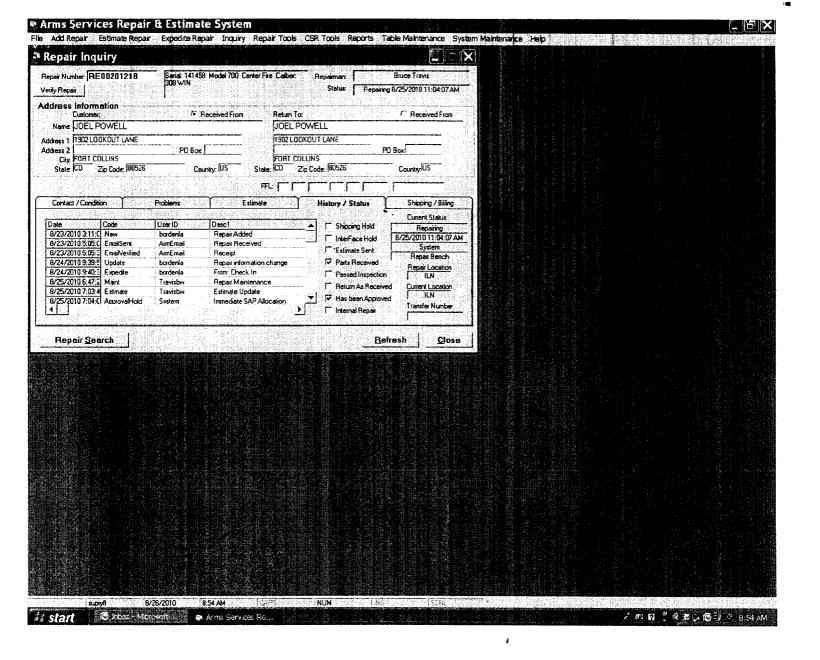

27. -20.23 35. \$2.23 37.

DECEIVET AUG 2 7 2010 BY: 4695

Please describe your problem:

Want to send gun in for the Bolt Lock Safety Modification, gun has discharged once when taking safety off to open the bolt.

Safety Not work, ug properly, it is not raising SEAR properly. Replace TPA, check over, clear under bolt Lock program for \$20.00 + 5+4.

Quote

377

characters left

NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time.

141458

Model: 700



RE00201218

VE OR SPENT SHELLS IN YOUR WITH THE FIREARM. THIS IS A YOU FEEL YOU MUST SEND SPENT SEPARATE PACKAGE AND INCLUDE E), TELEPHONE AND MODEL AND DE YOUR FIREARM.

your firearm before sending it. prevent further damage in shipping and erably, ship in a

:: Remove all accessories from your firearm to prevent loss or damage.
:: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not

responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.

Rrints:

Reset.