

Remington Arms Co., Inc.
Product Service
Legal Case #:5522

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
216550	12/28/2010	1/4/2011	1/4/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Rudolph	Buscher	100 South Vine	Chamois	MO	65024		H 573-763-5627

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038 Could Not Duplicate Concern		Unknown	
S	Fires on safety release Concern:1007 Fired on Safe Release			
C				

1/11/11 Per note with rifle, the rifle has a bolt lock and sometimes is goes off.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl	DOM
Remington	CF/BA	700/6MM REM	n/a	6648745	PX	6/1/1973
Date Purchased	Where Purchased	Accessories	Original Owner			
	WYETH CO ST JOSEPH MO	SCOPE BASE	Y			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test under BLSM price						
	Repair/Replacement Cost	Repair/Replacement Date				
	80.20	1/11/2011				

1/11/11 Per Ilion, could not duplicate concern. Trigger assm very dirty and sticky. Replace TPA, clean, test fire under BLSM program price of \$20 + S&H. Called customer for approval.cm

1/12/11 Owner approved. cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/4/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		22" 6MM REM
	Date Code		PX
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	

Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	ACTION VERY DIRTY
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.006
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY, STICKY
	Pull	---Select---	5.5#
	Altered	False	
	Sub-Assembly	M700 Bolt Lock	
Non-Remington Components	Description		SCOPE BASE

Remington.


Factory Repair Instructions

(NOTE: Please print and complete this form, and then include it with your firearm.)

Model Number: 700	Serial Number: 6648745
Are you the original owner? ☒ YES ☐ NO	
Name: RUDOLPH BUSCHER	Date of Purchase: ?
Address (no PO Boxes): 100 South Vine	
City: CHAMPAIGN	State: MO. Zip: 65024
Phone (Daytime): 573-763-5627	Fax:
E-mail Address: ☐ I would like to receive future e-mail updates from Remington.	
Please describe your problem: To put shell in you have to put on fire and when you remove shell you have to put on fire & sometimes it goes off	
Ammunition Information:	
Manufacturer:	Type:
Other (i.e. bullet weight/type, shot size, powder):	
Powder Weight:	
Primer Used:	
Reloader Used:	
of rounds)	
How often do you clean the trigger assembly? (Months or Number of rounds)	BY: JAN 05 2011
Brand of lubricant used:	

6648745

Model: 700

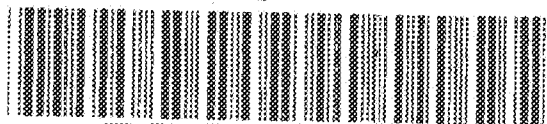

RE00216550

could not duplicate concern
T.A. VERY DIRTY & STICKY.
replace T.A. CLEAN & TEST FIRE
UNDER BLP' for \$70.00 + ship
Quote

22"
PKL/73
S.S.#
1006

