

Remington Arms Co., Inc.
Product Service
Legal Case #:5813

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
221628	2/2/2011	2/3/2011	2/3/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Robert J.	Clarke	1619 Bethel Rd.	Morganton	NC	28655		H 828-437-7856

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	Concern:1007 Fired on Safe Release			
C FSR				

Customer sent gun in with a note. He stated that he put the gun up years ago after he experienced a FSR. He stated he saw something on the internet & is sending it to us for repair. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPR	n/a	6354838	OT	7/1/1970
Date Purchased	Where Purchased	Accessories	Original Owner			
		TWO PIECE BASE	U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair under BLM program						

Repair/Replacement Cost	Repair/Replacement Date
\$30.40	2/17/2011

2/17/11: Per Ilion - TA very dirty, sticky & rusty. Trigger will not return properly. Replace TA, clean & test fire under BLM program - quote. Customer apprvd quote & pd. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		2/3/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE

Cause	4015	Improper Maintenance	
Barrel	Description		22" 3006 SPR
	Date Code		OT
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.007
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY, STICKY, RUSTY TRIG NOT RETURNING PROPERLY WILL FOLLOW DOWN
	Pull	---Select---	8#

	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

Could you please Kaplan
the sent at end of barrack

Also

~~Thanks~~
Clarke

Robert J. 221628
Ser. 6354838

Tried it again last night,

moved the safety & sure

enough, it went off - Jan. 17th.

2011

Robert J. Clarke
1619 Bethel Road
Morganton, N.C. 28655

Phone: 828-437-17856

T.A. very dirty, sticky & rusty.

Tag will not return properly.

Needs a TPA, clean & test fire.

UNCLAS BCP 6020 # 20.00 + ship

Quote

5813

A44-

This Rifle is very dangerous.

I put it up years ago

The last time it was used

I loaned it to a friend to

go deer hunting. He brought

it back & said when he

loaded the shell in, the gun

went off. I tried it

& when I moved the safety

"it went off" - Haven't touch

it since. Saw the note on

The Internet & sending it to

To you for repair

"over"

RECEIVED
FEB 04 2011

FEB 04 2011

BY:

22"
OT 7/7
8#
1007









