

Remington Arms Co., Inc.
Product Service
Legal Case #:5964

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
225076	3/4/2011	3/7/2011	3/7/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Michael	Conely	685 Country Dr	Fernley	NV	89408		H 775-575-5345 C 775-240-8677 E FrankieMike@charter.net

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	Fired when closing bolt	Concern:1008 Fired on Bolt Closing		
C				

3/15/11 Per note with rifle, it has prematurely fired at least twice when a round was picked up by the bolt action from the magazine and bolted into the bbl and the bolt closed. The safety was off and the trigger not touched or obstructed when the rifle discharged.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	A6781786	PV	6/1/1979
Date Purchased	Where Purchased	Accessories	Original Owner			
			U			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean and test fire under BLSM program price						

Repair/Replacement Cost	Repair/Replacement Date
30.40	3/15/2011

3/15/11 Per Ilion, trigger assm is contaminated with a dried and sticky lube residue causing parts to work sluggish. Replace TPA, clean and test fire under BLSM program price of \$20 + S&H.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		3/7/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4015	Improper Maintenance	
Barrel	Description		22" 3006 SPRG
	Date Code		PV
	Bore Plugged	False	
	Bulged	False	

	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	SLUGGISH
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	011
	Notch	Slightly Worn; Functioning	
	Test Fired	False	
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY, STICKY, PARTS WORK SLUGGISH. WILL FOLLOW DOWN AND DELAY FIRING
	Pull	---Select---	7#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	

 
5964

03-01-2011

22"

366/76
7#
1011

Model Number: <i>Remington 700 30.06.00</i>		Serial Number: <i>A 6781786</i>	
Name: <i>Michael J. Conely</i>		Date of Purchase: <i>Approx. 1980's</i>	
Address (no PO Boxes): <i>685 Country Drive</i>			
City: <i>FERNLEY</i>		State: <i>Nev.</i>	Zip: <i>89408</i>
Phone (Daytime): <i>775-575-5345</i> <i>Cell 775-240-8677</i>		Fax:	
E-mail Address: <i>Frankie Mike G. Chutkan.net</i>			
Please describe your problem: <i>The rifle has prematurely fired at least twice when a round was picked up by the bolt action from the magazine and bolted into the barrel and the bolt closed. The safety was off and the trigger not touched or obstructed when the rifle discharged.</i>			
500 characters left			
NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time.			

A6781786
Model: 700

RE00225076

DO NOT REMOVE OR SPENT SHELLS IN YOUR BOX WITH THE FIREARM. THIS IS A REQUIREMENT. IF YOU FEEL YOU MUST SEND SPENT SHELLS, THEY MUST BE IN A SEPARATE PACKAGE AND INCLUDE A LABEL WITH (NAME, ADDRESS, PHONE, TELEPHONE AND MODEL AND SERIAL NUMBER) OF YOUR FIREARM.

Inspect your firearm before sending it. To prevent further damage in shipping and handling, ship in a sturdy container.

DO NOT RETURN ORIGINAL BOXES (Original boxes may not be returned.)

- Remove all accessories from your firearm to prevent loss or damage.
- Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.

Print

Reset

RECEIVED
MAR 10 2011

BY:

T.A. is contaminated w/ a dried + sticky
LUBE residue causing parts to work
sluggish. Replace TPA, clean + test fire
under clip for \$20.00 + ship



