

Remington Arms Co., Inc.
Product Service
Legal Case #:5651

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
216218	12/27/2010	1/14/2011	1/14/2011				X

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Simmons Sporting Goods	Simmons Sportin	2001 Second Ave North	Bessemer	AL	35020			W 205-426-0490

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4013 Broken or Missing Parts		Unknown	
S	Concern:1040 Other - Firearms			
C	Gun is locked up			

1/27/11 Per note with rifle, gun is locked up, fired when moved off safe position.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	ML/BA	700/50 CAL	27588	ML093767	WR	8/23/1997
Date Purchased	Where Purchased	Accessories	Original Owner			
	SIMMONS SPORTING GOODS		U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/ML/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA at 1/2 normal cost						

Repair/Replacement Cost Repair/Replacement Date

1/27/11 Per Ilion, Trigger asm and action rusty. Firing pin striker broken, bolt asm rusted. Sear/trigger spring missing. Safety detent parts missing. Unable to repair aftermarket firing pin. Replace TPA at 1/2 normal cost. Customer approved repair by phone on 1/21.cm

Examination[Remington/ML/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/14/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4013	Broken or Missing Parts	
Barrel	Description		24" 50 CAL SS
	Date Code		WR
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn, Functioning	
	Firing Pin	---Select---	AFT MKT, BROKEN

Bolt	Shroud	Slightly Worn; Functioning	RUSTED
	Face	---Select---	
	Handle	Slightly Worn; Functioning	
	Stop	---Select---	
Overall	Exterior Condition	Worn; Not Functioning	DIRTY, RUSTY, PARTS MISSING
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 SAFETY
	Function	Slightly Worn; Not Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	
	Notch	Slightly Worn; Not Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	SEAR SPR AND SAFETY DETENT PARTS MISSING
	Pull	---Select---	N/A
	Altered	False	
	Sub-Assembly	M/700 Non-Bolt Lock	

5651
DATE RETURNED (12-14-10)

RETURN #

FROM: SIMMONS SPORTING GOODS
2001 SECOND AVENUE N.
BESSEMER, AL 35020
(205)426-0490

SHIPPED BY

UPS(✓) LBS
TRUCK() LBS
OF CARTONS

RETURNED BY CLAY
OF ITEMS 1
FACTORY RA#

RETURN TO: REMINGTON ARMS CO.
ATTN: ARMS SERVICE
14 HOFELER AVE
ILION NY 13357

REASON FOR RETURN: GUN IS LOCKED UP - FIRED
WHEN MOVED OFF SAFE POSITION - PLEASE
MAKE NECESSARY REPAIRS UNDER WARRANTY
AND RETURN ASAP. *Dennis Clay*


ITEMS RETURNED:

1 EA REMINGTON 700ML 50CAL STS/CAMO
ML093767 STOCK

T.A. + ACT. DUSTY. F.P. STRIKER BROKEN
Bolt ASSEMBLY rusted. SEAR/trigger spr. missing.
SAFETY decocker parts missing.
UNABLE TO REPAIR AFT. MKT. F.P.
Replace TPA AT 1/2 normal cost.

ML093767

 Quote



R# 216218

BY: _____

