

Remington Arms Co., Inc.
Product Service
Legal Case #:5929

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
224073	2/23/2011	2/24/2011	2/24/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	OH Valley Outdoors		OH Valley Outdo	2805 Columbus Lancaster Rd	Lancaster	OH	43130		W 740-654-4545

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components		Unknown	
S	Fired on safety release Concern:1007 Fired on Safe Release			
C				

3/9/11 Per note with rifle, firearm will discharge when the safety is removed.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700 /22-250 REM	84216	G6628546	XA	12/12/2006 12:39:00 AM
Date Purchased	Where Purchased	Accessories	Original Owner			
	W L BAUMLER CO		U			

CONCERN:PSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test fire at 1/2 normal cost						

Repair/Replacement Cost	Repair/Replacement Date

3/9/11 Per Ilion, trigger assem set screws altered. Trigger has min. return, will follow down. Replace TPA, clean, test fire at 1/2 normal cost.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B. TRAVIS
	Exam Date		2/24/2011
	Product Type		RF
	Action Type		A
	Assigned To		T. NAGLE
Cause	4006	Altered Adjustments or Components	
Barrel	Description		26" 22-250 REM HB
	Date Code		XA
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	

Bolt	Face	Slightly Worn; Functioning	BRASS WASH
	Handle	Slightly Worn; Functioning	
	Strip	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	METAL RUSTY
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		XMP SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.010
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	MIN TRIG RETURN WILL FOLLOW DOWN
	Pull	---Select---	2#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	X-Mark Pro	

5929

26"
XA 12/01
2#
010

Ohio Valley Outdoors
2805 Columbus Lancaster Rd.
Lancaster, Ohio 43130
(740)654-4545
FFL 4-31-045-02-1H-00603
2/11/2011

Manufacturer- REMINGTON

Serial Number- G6628546

Model- 700

Reason for Return- FIREARM WILL DISCHARGE WHEN THE SAFETY IS REMOVED!
REPLACE OR REPAIR LIKE NEW

Thank You,

 
Dawn Hamilton
Dan Libby

T.A. set screws altered. Trigger has
min return, will follow down.
Replace TPA, clean rest fire
At 1/2 normal cost

Quote

G6628546

Model: 700



RE00224073

RECEIVED
MAR - 2 2011

BY:.....







