

Remington Arms Co., Inc.
Product Service
Legal Case #:1000

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
124470	2/5/2007	2/6/2007	2/6/2007				

Customer Information

Type	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Mike	Brazda	Bayou Teche Guns 136 Market St/ PO Box 529	Arnaudville	LA	70512		H 337-754-5115

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components			Unknown
S	Follows down Concern:1031 Firing Pin Follows Down			
C				

Customer claims Remington changed the TA a year ago. Wherever it was done they installed a black TA with a modified bolt lock safety arm instead of the stainless TA that should have been installed in this ML. However, the TA set screw positions have all been altered. The engagement is minimal, the trigger pull is way under specifications. The person that altered the positions used a very heavy coating of glue over the screw heads. The follow downs occurred because of the alterations. As received it was difficult to get the bolt closed without having the firing pin follow down. fls 2/6/2007.

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/50	27588	ML055709	LR	2/28/1997
Date Purchased	Where Purchased	Accessories	Original Owner			
	SIMMONS GUN SPECIALTIES INC		U			

Customer says the gun is 2 years old

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Replace TA						
n/c						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$25.00	2/7/2007				

2/7/07-Altered adjustments, incorrect TA for this gun. lw

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		Supry
	Exam Date		2/6/2007
	Product Type		RF
	Action Type		A

1000

Bayou Teche Guns

P.O. Box 529
136 Market St
Arnaudville, La 70512
USA

Phone 337-754-5115
Fax 337-754-5115

January 22, 2007

Remington Arms Company, Inc.
Attn: Arms Service Division/Repairs
14 Hoeffer Ave.
Ilion, NY 13357

RECEIVED
FEB 07 2007
BY: *[Signature]*

Attention Service Dept:

Subject: Remington 700
Caliber .50
Ser # ML055709

Please inspect and correct. Trigger, and safety issues. Gun follows on closing. Original trigger did same thing, new trigger lasted one season and started following also. Probably a striker firing pin issue. Gun is only 2 years old.

Altered Adjustments, incorrect TA
for this gun.

Install a stainless TA n/c
Charge 230145

Firing Pin Assembly dirty
& rusty spring - clean or replace.

FLS 2/6/2007

Thank You,


Mike Brazda

Mike Brazda
Bayou Teche Guns

124470

Serial Number: **ML055709**

Model: **700ML**

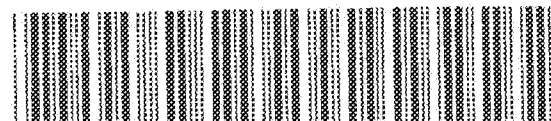

RE00124470

PS 20370

5/27/74

Repair Inquiry

Repair Number:	RE00124470	Serial: MLD35709 Model: 700ML Center Fire	Repairman:	Carl Cotton
Verify Repair:		Caliber: 50 STAINLESS SYN Produced:	Status:	Shipped 2/8/2007 4:00:01 PM
		02/28/1997		

Discussion

Received from

Return To

Received from

Name: BAYOU TECHE GUNS

BAYOU TECHE GUNS

Address: 136 MARKET STREET

130 MARKET STREET

Address: _____ PO Box _____

FD Box

CH. ORRADOVILLE

BRANDVILLE

State: IL

Zip Code: 170512

County: 09State LA

Zip Code: 70512

Country: US

FILE							
------	--	--	--	--	--	--	--

Contact & Condition

Problems

Exercises

History / StatusShipping / Billing

Problems Reported

Date	Desc
M123	FORWARD TO PRODUCT SE
M390	"GUN FOLLOWS ON CLOSIN

Problems Found

Code	Desc
M122	RUSTED COMPONENT
M179	TRIG ADJ SCREWS RESET.

Reps: Notes

First time at the factory for repair. Trigger asm. was installed outside of factory. Firing pin and nipple not of our manufacturing. Cleaned bolt and firing pin and installed

Repairman's Comments

- CSR Comments

Repair Search

Refresh

Close