

Remington Arms Co., Inc.
Product Service
Legal Case #:3069

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
157455	1/13/2009	1/14/2009	1/14/2009				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Cpl J. Scott	Stidman						W 479-444-3454 C 479-601-3578
Reporter	Fayetteville PD	Fayetteville PD		100 A West Rock St	Fayetteville	AR	72701		W 479-444-3454 C 479-601-3578

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
FI				
PD				
S	Fires when closing bolt	Cause:4038 Could Not Duplicate Concern Concern:1020 Fired on Bolt Opening		Unknown
C				

1/15/09 According to letter with rifle, on 12/2/08, while in sniper training, it went off when closing the bolt. Hand was not near trigger. He had just shot a cold bore shot, waited and was going to shoot a 6 shot scope adjustment drill. Prior to shooting his 2nd shot, he chambered a round but was not ready to shoot. He attempted to put on the saety but it would not go. He raised the bolt and noticed that the center of the bolt did not spring out. As he worked the bolt and moved it back down to the locked position it fired.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/308 WIN	25713	D6282325	DT	9/30/1999 10:09:21 AM
Date Purchased	Where Purchased	Accessories	Original Owner			
	FAYETTEVILLE POLICE DEPAR	TWO PIECE SCOPE BASE,BOTTOM HALF OF RINGS	U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement - None Defined

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/14/2009
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4038	Could Not Duplicate Concern	
	Description		20" 308 WIN HB CUSTOM SS
	Date Code		DT

Barrel	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Magazine	Condition	---Select---	
	Box Condition	Missing	
Overall	Exterior Condition	Worn; Functioning	
	Stock Condition	Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M700 SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.015
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	40X TPA DIRTY/RUSTY
	Pull	---Select---	3#
	Altered	False	
	Sub-Assembly	Other Remington	
Non-Remington Components	Description		TWO PIECE SCOPE BASE,BOTTOM HALF OF RINGS

Repair Inquiry

Repair Number: **RE00157455**Serial: DG20225 Model: 700 Center Fire Caliber:
308 WIN Produced: 09/20/1999

Repsman:

Chuck Dekanek

Verify Repair

Status:

Estimating 1/13/2009 12:59:10 PM

Address Information

Customer:

Received From:

Return To:

Received From:

Name: **FAYETTEVILLE POLICE DEPT****FAYETTEVILLE POLICE DEPT**Address 1: **FIREARMS J S STIDMAN****FIREARMS J S STIDMAN**Address 2: **100 A WEST ROCK ST** PO Box:**100 A WEST ROCK ST** PO Box:City: **FAYETTEVILLE****FAYETTEVILLE**State: **AR**Zip Code: **72701**Country: **US**State: **AR**Zip Code: **72701**Country: **US**

FPL:

Contact / Condition

Problem

Estimate

History / Status

Shipping / Billing

Date	Code	User ID	Desc1	Desc2
12/15/2008 7:24	New	valentis	Repair Added	
12/18/2008 7:25	Update	valentis	Repair information change	
12/19/2008 7:26	Expedite	valentis	From: Check In	To:
1/13/2009 12:59	Expedite	dekanekc	From: Custom Shop	To: Repair Cent
1/13/2009 1:01	Expedite	dekanekc	From: Repair Bench	To:
1/13/2009 1:07	Maint	Trevistaw	Repair Maintenance	Status: Estimate
1/14/2009 7:25	Maint	Trevistaw	Repair Maintenance	Status: Estimate
1/14/2009 8:57	Expedite	dekanekc	From: Product Services	To:

☐ Shipping Hold☐ Interface Hold☐ Estimate Sent☐ Parts Received☐ Passed Inspection☐ Return As Received☐ Has been Approved☐ Internal Repair

Current Status:

Estimating

1/13/2009 12:59:10 PM

dekanekc

Custom Shop

Repair Location

EST

Center Location

ILN

Transfer Number

Repair Search

Refresh

Close

RUCVH

1/14/2009

9:01 AM

DNPC

NUN

JRL

SCB

Helen

Inbox - Microsoft Outlook

Arms Services Repair

PS Host Guns A3

PS 20571


5069

DT 9/99
20"
3"
015

MEMORANDUM

Serial Number: D6282325X

Model: 700

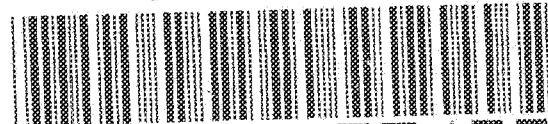

RE00157455

TO: Sgt. Doug Pope

FROM: Cpl. Gary R. Crews

DATE: 12-4-08

SUBJECT: Unintentional Discharge of Remington 700 Rifle.

On 12-2-08, while participating in sniper training, my Remington 700 rifle went off when I closed the bolt. My hand was no where near the trigger when this happened. I had just shot a cold bore shot, waited and was going to shoot a 6 shot scope adjustment drill. Prior to shooting my second shot, (the start of the scope drill), I chambered a round but was not quite ready to shoot. I attempted to put the safety on the rifle, but the safety lever would not go in the safe position. This normally means a round has been fired and the bolt needs to be raised in order to cock the firing pin. I raised the bolt and noticed that the center of the bolt did not "spring" out. As I again worked the bolt, I moved the bolt down to the locked position and the weapon fired.

It is possible to work the bolt up, and with very slight forward pressure, the bolt will not re-engage the firing pin. This does not however, explain how the bolt was worked to the rear, the first round ejected, the bolt closed, the second round seated and it did not go off until the bolt was raised and closed again

As you know, I have been handling weapons in a professional setting for some 26 years now and have never had anything similar happen. I would write this off as an extreme freak incident had I not seen it happen now on two separate occasions with two different Remington 700 rifles.

could not duplicate concern.

TRIG. ASSM DIRTY + RUSTY.

replace TPA, check over, clean AT

H/C

230145

Remington arms Company
Attention: Arms service Division
14 Hoefler Ave
Ilion, New York
13357

It is possible that the trigger mechanism on this Remington Model 700 LTR has been adjusted by someone other than as set at the factory. Would you please check the trigger mechanism on this rifle and set or repair it back to factory specifications.

The rifle serial number is D6282325

This is a duty weapon.

Thank you

Cpl. J. Scott Stidman #100
Fayetteville Police Department
Firearms Division/ Training
100 A. West Rock Street
Fayetteville, Arkansas
72701
(479) 444-3454 (office)
(479) 601-3578 (cell)
sstidman@ci.fayetteville.ar.us

Cpl. J. Scott Stidman #100

This rifle was packaged in an unloaded condition.

It has been checked by Cpl. Scott Stidman #100

Fayetteville Police Department Firearms
Division