Page 1 of 2 PrintDisplay

> Remington Arms Co., Inc. Product Service Legal Case #:6300

Case Information

Date Opened(PS) **Date Closed** RE# Date Opened **Incident Date** Pre Lit Lit Obsolete 234091 6/21/2011 6/22/2011 6/22/2011

**Customer Information** 

Type **Business** First Name Last Name Street State Zip Contact Age Reporter All Seasons Sports All Seasons Spo 720 Hwy 12 Delano MN 55328 W 763-972-3112

Incident Information

Medical Repair Medical Claims Codes Est. Treatment Status

PΙ

PD Cause: 4015 Improper Maintenance

Concern:1025 Unexplained Discharge - No Mention of Safety Position Unknown S

Gun fires on its

C

Dealer sent gun in. Dealer stated that gun fires on its own. df

Firearm Information

SKU Model/Ga. Mfg. Type Serial Bbl. DOM Remington CF/BA 700/3006 SPRG 25773 B6515321 RD 11/1/1983

Where Purchased **Original Owner Date Purchased** Accessories

WHITE STORES LUFKIN TX TWO PIECE BASE, AFT MKT STK U

CONCERN: FIRES ON IT'S OWN

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Reim. Date Cash Date Cash Settlement Release of Claims Release Date Reimbursement Settlement APV APV

Per Ilion - Quote to repair

## Repair/Replacement Cost Repair/Replacement Date

7/8/11: Per Ilion: TA is contaminated w/a partially dried & sticky lube residue causing parts to bind & work sluggish. Replace TA, clean & test fire @ 1/2 normal cost - quote. I spoke to Shawn @ store & he is mailing a check as payment. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	_ Examiner	-	B.TRAVIS
	Exam Date		6/22/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4015	Improper Maintenance	
Barrel	Description		22" 3006 SPRG
	Date Code		RD
	Bore Plugged	False	
	Bulged	False	]
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown	Slightly Worn; Functioning	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6300&Type=Case

7/8/2011

	Condition		
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
-113	Exterior Condition	Slightly Worn; Not Functioning	
Overall	Stock Condition	Select	AFT MKT SYN
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		M/700 SAFETY
Safety	Function	Like new; Functioning	]
	Sub-Assembly	Non-ISS	
	Lift	Select	.011
Sear	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	16505	False	
Trigger	Condition	Slightly Worn; Not Functioning	STICKY LUBE RESIDUE PARTS BIND,WORK SLUGGISH
	Puli	Select	6.5#
	Altered	True	SEALANT REMOVED FROM PULL SCREW
	Sub-Assembly	M/700 Non-Bolt Lock	]
Non-Remington Components	Description		TWO PIECE BASE,AFT MKT STK

2211 KP 11/83 .011

og, 75 own. Please report return to: All Seasons Sports

Model: 700

RE00234091

T.A. is contaminated w/Apartially DRIED & STICKY he be insidue CANING pants to bind work sluggish. Lephaer TPA, clears tost Rine At 1/2 NORMAL COST

Quate

	ZC	عَ ز	<u>I</u>	<b></b> 2011	
	JUL	0	6	2011	
В	Y:				







