

Remington Arms Co., Inc.
Product Service
Legal Case #:6274

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
233239	6/8/2011	6/10/2011	6/10/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Michael	Brown	10410 Horseshoe Bend	Houston	TX	77064		H 281-451-3375 E mwblips@att.net

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038 Could Not Duplicate Concern		Unknown	
S	Concern:1008 Fired on Bolt Closing			
C FBC				

Customer sent gun in w/our repair form - stated he had FBC and wanted the bolt lock modification. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/7MM REM MA	n/a	A6898799	KA	5/11/1980
Date Purchased	Where Purchased	Accessories	Original Owner			
5/1/2000	K MART ENT NEWNAN GA		N			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair under BLM						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$30.40	6/24/2011				

6/24/11: Per Ilion - Could not duplicate concern. TA dirty, sticky, rusty. Replace TA, clean & test fire under BLM - quote. Customer apprvd & paid by credit card. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		6/10/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		24" 7MM REM MAG
	Date Code		KA
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	

Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	ACTION RUSTY
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.010
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY,STICKY,RUSTY
	Pull	---Select---	3#
	Altered	True	APPEARS PULL SCREW ALTERED
	Sub-Assembly	M/700 Bolt Lock	

User Name

 Log in[Help](#)[Register](#)☐ Remember Me?[Home](#)[Forum](#)[Blogs](#)[What's New?](#)[New Posts](#)[Today's Posts](#)[FAQ](#)[Calendar](#)[Community](#)[Forum Actions](#)[Quick Links](#)[Advanced Search](#)* [Forum](#)[Firearms](#)[Bolt Action Rifles](#)[Remington 700 recall notice](#)

If this is your first visit, be sure to check out the **FAQ** by clicking the link above. You may have to **register** before you can post: click the register link above to proceed. To start viewing messages, select the forum that you want to visit from the selection below.

[+ Reply to Thread](#)

Results 1 to 1 of 1

Thread: Remington 700 recall notice[Thread Tools](#)[Display](#)

10-27-2009 08:44 PM

#1



Chris
TacticalAdv Staff

Join Date: Sep 2008
Location: Orange Texas
Posts: 1,857
Blog Entries: 1

Remington 700 recall notice**Safety Modification Program****Remington Model 700 & Model 40-X**

If you own a Remington Model 700 or Model 40-X rifle:

Only those Model 700 or 40-X rifles made before March 1982 were manufactured with a bolt-lock mechanism. Model 700 or 40-X rifles made after March 1982 do not have a bolt-lock mechanism and may be loaded and unloaded with the safety in the "S" or "On Safe" position. Consequently, post-1982 Model 700 or 40-X rifles are not subject to this bolt-lock Safety Modification Program.

To determine whether your Model 700 or 40-X rifle has a bolt-lock mechanism, either:

- Call Remington toll-free at 1-877-387-6691 and a service representative will help you determine if your firearm has a bolt-lock mechanism, or
- Take your Model 700 or 40-X rifle to a Remington Authorized Repair Center and a qualified gunsmith will examine your firearm and determine whether it has a bolt-lock mechanism.

If your Model 700 or 40-X rifle has a bolt-lock mechanism, it is eligible for this bolt-lock Safety Modification Program. If you participate, your firearm will be cleaned and inspected for proper functioning by a qualified gunsmith. Once the condition of your firearm has been assessed, you will be notified of one of the following:

- Your firearm's trigger assembly is otherwise in good operating condition, and the gunsmith will proceed to physically remove the bolt-lock feature so that your rifle can be loaded and unloaded while the safety remains in the "S" or "On Safe" position; or
- Your rifle's trigger assembly is found to be in an unsatisfactory or potentially unsafe operating condition because of any number of factors, including wear, alteration or maintenance. The entire trigger assembly will be replaced with a new factory trigger assembly, which does not incorporate a bolt-lock mechanism.

In either case, the total cost to you is \$20 plus shipping and handling. You will also receive a safety redemption certificate to complete and submit in order to receive a free blaze orange hat (one hat per certificate).

How to participate in the Safety Modification Program

Complete the General Repair Form and
Send or deliver your firearm and the completed repair form to either:

- a) A Remington Authorized Repair Center; or
- b) Ship your firearm to the Remington factory at:
Remington Arms Company, Inc.
Ilion Firearms Plant
Attention: BL Safety Program
14 Hoefer Avenue
Ilion, NY 13357

Remington will bill or arrange for payment once your firearm is received and evaluated.

CAUTION: It is your responsibility to comply with all laws and regulations regarding transportation or shipping of your firearm. Absolutely no ammunition should be packaged with the firearm whether loaded in the firearm itself or included in the shipping container. The firearm should be transported only in a completely unloaded condition.

NRA Certified Instructor
Glock Certified Armorer
Gunsmith
Owner Tacticaladv.com

Reply With Quote

+ Reply to Thread

Quick Navigation

Bolt Action Rifles

Top

6274

Model Number: 700 7 MAG.		Serial Number: A6898799	
Name: MICHAEL BROWN		Date of Purchase: 5-1-2000	
Address (no PO Boxes): 10410 HORSESHOE BEND			
City: HOUSTON		State: TX	Zip: 77064
Phone (Daytime): 281-451-3375		Fax:	
E-mail Address: MWBLIPS@ATT.NET			
Please describe your problem:			
<p>SAFETY RECALL BOLT LOCK MOD. PROGRAM. LAST SEASON, IT DID GO OFF (FIRED) WHEN CHAMBERING A ROUND. ALSO, COULD YOU INSTALL 4 SCREWS ON THE BARREL (FRONT & BACK SIGHTS). I USE A SCOPE, PLEASE ADD TO TOTAL COST? I WILL PAY.</p>			
500 characters left			

24"
KAS
3#
1010

2 GUNS w/ CASE



contact the Repair Center for services

A6898799

Model: 700



RE00233239

IF SPENT SHELLS IN YOUR FIREARM
 REARM. THIS IS A VIOLATION OF
 MUST SEND SPENT SHELLS PLEASE
 AGE AND INCLUDE NAME, ADDRESS
 MODEL AND SERIAL NUMBER OF

RECEIVED
 JUN 22 2011

- Record the serial number of your firearm before sending it.
- Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)
- Remove all accessories from your firearm to prevent loss or damage.
- Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.

could not duplicate concern
 T.A. dirty, sticky, rusty. Replace
 TPA, clean fast fire and
 Bul for 20.00 + ship









