Remington Arms Co., Inc. **Product Service** Legal Case #:6293

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete 6/16/2011 6/17/2011 6/17/2011 233483

Customer Information

Business First Name Last Name Street City State Zip Age Contact Type 2890 Acquest Ave SE Reporter Gander Mt Gander Mt Kentwood MI 49512 W 616-975-1000

Incident Information

Medical Medical Claims Repair Est. Codes **Treatment** Status

PΙ

PD Could Not Duplicate Cause:4038

Concern Unknown Fired when safety

S released Concern: 1007 Fired on Safe Release

C

6/24/11 Per note with firearm, customer says rifle discharged when safety moved to fire. He would like to have new MarkX Pro Trigger installed.cm

Firearm Information

SKU Mfg. **Type** Model/Ga. Serial Bbl. **DOM** 700/270 WIN Remington CF/BA n/a 54355 BK 1/1/1963 **Date Purchased** Where Purchased Accessories **Original Owner**

SCOPE BASE U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Reim. Cash Cash Reimbursement Settlement Release of Claims Release Date Date Date Settlement **APV APV**

Per Ilion, replace TPA, clean, test at BLSM program price

> Repair/Replacement Repair/Replacement Date Cost

> > 66.00 6/24/2011

Per Ilion, replace TPA, clean, test at BLSM program price of \$20 + shipping and tax.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		6/17/2011
	Product Type		RF
	Action Type		A

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6293&Type=Case

 
6/24/2011

	Assigned To		T.NAGLE_
Cause	4038	Could Not Duplicate Concern	
	Description		22" 270 WIN
	Date Code		ВК
	Bore Plugged	False	
Barrel	Bulged	False	
	Fired	False	
	Fired while Obstructed		-
	Muzzle/Crown Condition	Slightly Worn; Functioning]
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning]
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False]
	Description		M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	Select	.008
Sear	Notch	Slightly Worn; Functioning	O/S DOUBLE
	Tacts	Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Functioning	TRIG HAS MIN RETURN
Trigger	Pull	Select	2.5#
Trigger	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE BASE



6293

Service Request Service Order # 7713



SHIPPED TO VENDOR/STORE:

Remington Repair FFL# 6-16-00727 14 Hoefler Ave

Ilion, NY 13357

Attn:

Date Shipped: 06/07/2011

Phone: (800) 243-9700

RETURN SHIP TO:

Gander Mountain, FFL# 4-38-081-01-7b-02241

Attn: Gun Parts Dept. 2890 Acquest Ave SE

Kentwood, MI 49512

FIREARM INFORMATION:

Manufacturer: Remington Arms Co Inc.

Type:

Rifle

Serial Number: 54355

Cased?:

Model:

700 BDL

Cal/Ga.: 270 cal

DESCRIPTION OF ITEM RETURNED:

Model 700 BDL, no rear sight, with Burris one-piece base.

REASON FOR RETURN:

Customer says rifle discharged when safety moved to Fire. Would like to have new Mark X Pro trigger installed.

ATTENTION VENDOR

Please contact me with any questions or concerns.

Kent Will (616) 975-1000

BILLING INFORMATION:

Please include the service order number on all invoices and correspondence:

SHIP TO ABOVE ADDRESS

Forward all invoices to:

GANDER MOUNTAIN COMPANY

ATTN: CINDY KILRIDE 180 E. Fifth Street Suite 1300

St. Paul, MN 55101

DECERVED L jun 2 2 2011

BY:----

54355 Model: 700

E00233483

Could not duplicate concern.

TRIQ. Set screws Altered TRIQ.

has min return. Replace TOB,

clear + Test fine under BCP

Lor & Zo. 00 + Shipping

Quote

(616) 975-1000 From: Receiving Lead Gander Mountain Company 2890 Acquest Avenue South East

Ship Date: 07.JUN11 ActWgt. 10.0 LB CAD: 101906462/INET3130

Dept#

Gunsmith SO 7253

Invoice # Reference#

P0#

KENTWOOD, MI 49512

 
SHIP TO: (800) 243-9700


Repairs

Remington Arms Co

14 HOEFLER AVE

ILION, NY 13357



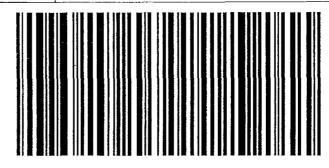

(9612883) 0541315 15009118

HOME

883 ADULT SIGN

of

After printing this label:

1. Use the 'Print' button on this page to print your label to your laser or inkjet printer.

2. Fold the printed page along the horizontal line.

3. Place label in shipping pouch and affix it to your shipment so that the barcode portion of the label can be read and scanned.

Warning: IMPORTANT: TRANSMIT YOUR SHIPPING DATA AND PRINT A MANIFEST:

At the end of each shipping day, you should perform the FedEx Ground End of Day Close procedure to transmit your shipping data to FedEx. To do so, click on the Ground End of Day Close Button. If required, print the pickup manifest that appears. A printed manifest is required to be tendered along with your packages if they are being picked up by FedEx Ground. If you are dropping your packages off at a FedEx drop off location, the manifest is not required.

Use of this system constitutes your agreement to the service conditions in the current FedEx Service Guide and applicable tariff, available upon request. FedEx will not be responsible for any claim in excess of \$100 per package, whether the result of loss, damage, delay, non-delivery, misdelivery, or misinformation, unless you declare a higher value, pay an additional charge, document your actual loss and file a timely claim. Limitations, including limitations on our liability, can be found in the current FedEx Service Guide and applicable tariff apply. In no event shall FedEx Ground be liable for any special, incidental, or consequential damages, including, without limitation, loss of profit, loss to the intrinsic value of the package, loss of sale, interest income or attorney's fees. Recovery cannot exceed actual documented loss. Items of extraordinary value are subject to separate limitations of liability set forth in the Service Guide and tariff. Written claims must be filed within strict time limits, see current FedEx Service Guide.









