

Remington Arms Co., Inc.
Product Service
Legal Case #:6275

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
233320	6/8/2011	6/10/2011	6/10/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Jesse	Quintanilla	3414 Trafalger Ct	LaFayette	IN	47909		H 765-474-0693 E elzquint@frontier.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	Fired when moving from safe to fire	Cause:4006 Altered Adjustments or Components Concern:1007 Fired on Safe Release	Unknown	
C				

6/24/11 Per note with rifle, gun has gone off from safety to fire without hitting the trigger.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/270 WIN	n/a	A6294216	CI	4/29/1976
Date Purchased	Where Purchased	Accessories	Original Owner			
8/7/1980	WAYNE HDWE CO FORT WAYNE IN	SCOPE BASE,BOTTOM HALF RINGS	U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test fire under BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	30.40	6/24/2011				

6/24/11 Per Ilion, trigger assm dirty, set screws altered. Replace TPA, clean, test fire under BLSM program price of \$20 + shipping.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		6/10/2011

Examination	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
Barrel	Description		22" 270 WIN
	Date Code		CI
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	SLUGGISH
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	NOT ORIGINAL STOCK
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.009
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY, SLUGGISH
	Pull	---Select---	3.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE BASE, BOTTOM HALF RINGS

22
CI 4/7
3.5
1009

Factory Repair Instructions

Model Number: 700	Serial Number: A6294216
Are you the original owner?: ☐ YES ☒ NO	
Name: Jesse Quintanilla	Date of Purchase: 8-7-1980
Address (no PO Boxes): 3414 Trotter Ct	
City: Lafayette	State: IN Zip: 47909
Phone (Daytime): 765-474-0693	Fax:
E-mail Address: ☒ ELZQUINT@FRONTIER.COM I would like to receive future e-mail updates from Remington.	
Please describe your problem: Gun has gone off from Safety to fire without hitting the trigger	
Ammunition Information:	
Manufacturer: Remington	Type: 140 grains bullets
Other (i.e. bullet weight/type, shot size, powder):	
Handload Information:	

Manufacturer: Remington	Type: 140 grains bullets
Other (i.e. bullet weight/type, shot size, powder):	

Handload Information:

Powder Weight:	1.200g
Primer Used:	JUN 22 2011
Reloader Used:	

BY: _____

TPA dirty, set screws A/Horod.
Replace TPA, clean & test fine
under BCP for 2000+ hrs

Number of rounds)	under BCP Lord 2000 + ship
Number of rounds)	
Months or Number of rounds)	

Brand of lubricant used:

Serial Number:

A6294216

Model: 700



RE00233320







