Remington Arms Co., Inc. **Product Service** Legal Case #:6088

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete 4/5/2011 4/6/2011 4/6/2011 227784

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact 1123 W. 52nd Ave Incident Seth Smith Kennewick WA 99337 H 509-582-1113

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

ΡI

PD Fired when closing

Cause:4038 Could Not Duplicate Concern

S

Concern: 1008 Fired on Bolt Closing

Unknown

C

4/8/11 Per note with rifle, this rifle has the bolt lock. He is sending it for the conversion however it has occasionally discharged a round when it was being chambered, as soon as the bolt is rotated into battery.cm

Firearm Information

Mfg. Remington

Type CF/BA

Model/Ga. 700/7MM REM MA SKU n/a

Serial Bbl. DOM

Date Purchased

Where Purchased

Accessories

Original Owner

239946 DN 9/1/1966

SCOPE BASE

U

CONCERN: FSR,FBC

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement

Release of Claims

Release Date

Reimbursement

Cash Settlement

Cash Reim. Date

Date APV APV

Per Ilion, replace TPA, clean, test fire at BLSM price

Repair/Replacement Repair/Replacement

Cost

45.40

Date 4/8/2011

4/8/11 Per Ilion, could not duplicate concern. Trigger assm dirty and sticky and set screws altered. Replace TPA, clean, test fire at BLSM price of \$20 + shipping.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		4/6/2011
	Product Type		RF
	Action Type		A

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6088&Type=Case

4/8/2011

	Assigned To]	T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		24" 7MM REM MAG
	Date Code	1	DN
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		•
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.010
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	10313	False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY,STICKY.MIN RETURN ON TRIG
	Pull	Select	2#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE BASE

6088

24 DN9/66 24

This is one of the older model 700s that requires the safety to be off in order to work the action of the rifle and I am sending it in for your conversion program. Another problem that this rifle has is that it will occasionally discharge a round when it is being chambered, as soon as the bolt is rotated into battery. Please address this problem as you see fit. Thanks a bunch,

Seth Smith 1123 W 52nd ave Kennewick, WA 99337 (509)-582-1113

239946

RE00227784

20,40 27--78/2.40 37.-45.40

could not dup li coste concern.

T.A. dinty + sticky + set scruws

Altered. Pup how TPA, clean + tost

Fine under BLP Corts 20.00 + ship

Quote

APR 0 7 2011









