Remington Arms Co., Inc. **Product Service** Legal Case #:6319

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete 6/29/2011 6/30/2011 234626 6/30/2011

Customer Information

Street Contact Type Business First Name Last Name City State Zip Age H 541-659-2260 Incident August M Yerges, Sr 667 Minnow Ln Wilderville OR 97543 E deann.augie@yahoo.com

Incident Information

Medical Medical Claims Codes Repair Est. **Treatment** Status

PI

PD Could Not Duplicate Cause:4038

Concern Unknown Fired when safety was

Concern:1007 Fired on Safe Release released

 $\mathbf{C}$ 

7/8/11 Per letter with rifle, Yerges was hunting last season and was prepared to shoot a deer. He released the safety and when he pulled the trigger the rifle did not fire. He inspected the rifle and when he moved the safety it fired. It happened more than once that day.cm

Firearm Information

SKU Mfg. Model/Ga. Serial Bbl. DOM Type Remington CF/BA 700/3006 SPRG n/a 6727276 AY 3/1/1974

**Date Purchased** Where Purchased Accessories **Original Owner** 

JENSEN BYRD SPOKANE WASH TWO PIECE BASE U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Cash Reim. Cash Settlement Release of Claims Release Date Reimbursement Date Date Settlement APV APV

Per Ilion, replace TPA, clean, test at BLSM program price

Repair/Replacement Repair/Replacement

Cost Date 40.62 7/8/2011

7/8/11 Per Ilion, could not duplicate concern. Trigger assm dirty and rusty. Parts work sluggish. Replace TPA, clean, test at BLSM program price of \$20 + shipping.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		6/30/2011

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6319&Type=Case

7/8/2011

Examination	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
	Description		22" 3006 SPRG
	Date Code		AY
	Bore Plugged	False	
Barrel	Bulged	False	
Darrei	Fired	False	
	Fired while Obstructed	i	
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	SLUGGISH
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Worn; Functioning	METAL RUSTY REC'D UNASSM
	Stock Condition	Worn; Functioning	MARS,DENTS,SCRATCHES
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
	Description		M.700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.007
	Notch	Slightly Worn; Functioning	
Faeding Test	Tests	Test Fired False	False
Feeding Test			DIDTY DISTY DARTS WORK
Trigger	Condition	Slightly Worn; Functioning	DIRTY,RUSTY,PARTS WORK SLUGGISH
	Pull	Select	4.5#

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6319&Type=Case

7/8/2011

	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

June 20, 2011

Remington Arms Company Ilion Firearms Plant Attention: BL Safety Program 14 Hoefler Avenue Ilion, NY 13357



Dear Remington;

Enclosed is one (1) Remington Rifle, Model 700L, Serial Number 6727276. I am sending it to you to correct the safety problem as described below:

I was hunting last season and was prepared to shoot a deer. I released the safety and when I pulled the trigger, the rifle did not fire. I then inspected the rifle and when I moved the safety it fired. This happened more than once that day.

My wife-spoke to a representative at Remington and they said to send the rifle in. I have also enclosed a copy of the internet information that we found about the safety issue.

If you have any questions, please contact me at 541-659-2260.

Please return the rifle to: August M. Yerges, Sr. 667 Minnow Lane Wilderville, OR 97543

Phone: 541-659-2260

Email: deann.augie@yahoo.com

Thank you for your attention to this matter.

august 11.

August M. Yerges, Sr.

Could not deplicate concern T. A. dirly + mosty parts work stuggish. Replace TPA clear + Test Like UNDER BLP Con 81 20.00 + Ship

Q wole

DECERVED A JUL 0 6 2011 BY:

## REMINGTON MODEL 700 & MODEL 40-X

If you own a Remington Model 700 or Model 40-X rifle:

Only those Model 700 or 40-X rifles made before March 1982 were manufactured with a bolt-lock mechanism. Model 700 or 40-X rifles made after March 1982 do not have a bolt-lock mechanism and may be loaded and unloaded with the safety in the "S" or "On Safe" position. Consequently, post-1982 Model 700 or 40-X rifles are not subject to this bolt-lock Safety Modification Program.

To determine whether your Model 700 or 40-X rifle has a bolt-lock mechanism, either:

Eastern Time

Call Remington toll-free at 1-877-387-6691 and a service representative will help you determine if your firearm has a bolt-lock mechanism, or

Take your Model 700 or 40-X rifle to a Remington Authorized Repair Center and a qualified gunsmith will examine your firearm and determine whether it has a bolt-lock mechanism.

If your Model 700 or 40-X rifle has a bolt-lock mechanism, it is eligible for this bolt-lock Safety Modification Program. If you participate, your firearm will be cleaned and inspected for proper functioning by a qualified gunsmith. Once the condition of your firearm has been assessed, you will be notified of one of the following:

Your firearm's trigger assembly is otherwise in good operating condition, and the gunsmith will proceed to physically remove the bolt-lock feature so that your rifle can be loaded and unloaded while the safety remains in the "S" or "On Safe" position; or

Your rifle's trigger assembly is found to be in an unsatisfactory or potentially unsafe operating condition because of any number of factors, including wear, alteration or maintenance. The entire trigger assembly will be replaced with a new factory trigger assembly, which does not incorporate a bolt-lock mechanism.

In either case, the total cost to you is \$20 plus shipping and handling. You will also receive a safety redemption certificate to complete and submit in order to receive a free blaze orange hat (one hat per certificate).

How to participate in the Safety Modification Program

Complete the Congret Page's Form and Cond or do	the same and the completed associations to although the same and the s
a) A Remington Authorized Repair Center; or	liver your firearm and the completed repair form to either:
b) Ship your firearm to the Remington factory at:	11 Called 10 10 days
,	6-14-11 Sand Rufte Ownantie
Remington Arms Company, Inc.	1) -
Ilion Firearms Plant	11tole of law Long Will it take
Attention: BL Safety Program	The book of the same of the sa
14 Hoefler Avenue	were and a code of the code of
Ilion, NY 13357	- De light Old ass.
Remington will bill or arrange for payment once you	diver your firearm and the completed repair form to either: of Bubendown 6-14-11 Called  1) Send Right dismant be wanted with the word will, thake week and evaluation of the company to the company to the point received and evaluation of the company to the compa

www.handymanclub.com







