Remington Arms Co., Inc.
Product Service
Legal Case #:6486

Case Information

 RE#
 Date Opened
 Date Opened(PS)
 Date Closed
 Incident Date
 Pre Lit
 Lit
 Obsolete

 238658
 8/22/2011
 8/23/2011
 8/23/2011

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact

Reporter Cabela's Kale Cabela's 475 E. Hartford Blvd North East Hartford CT 06118 W 860-290-6200 x 8211

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

ΡI

PD Cause:4015 Improper Maintenance
S Fires when closing bolt Concern:1008 Fired on Bolt Closing
Unknown

~

8/26/11 Per note with rifle, according to the customer, the firearm sometimes discharges when the bolt is closed and the trigger is not pulled and the action is loose in the stock.cm

Firearm Information

SKU DOM Mfg. Type Model/Ga. Serial Bbl. Remington CF/BA 700/3006 SPRG n/a A6334905 OI 7/1/1976 **Date Purchased** Where Purchased Accessories **Original Owner** FOLSOM MAHWAH NY TWO PIECE BASE U

CONCERN: FBC

Ammunition Information - None Defined
Other Products Information - None Defined
Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Settlement Date APV Cash Date APV PV

Per Ilion, replace TPA, clean and test fire under BLSM program price

Repair/Replacement
Cost
42.40
Repair/Replacement
Date
8/26/2011

8/26/11 Per Ilion, trigger assm dirty and has a sticky lube residue causing parts to work sluggish. Replace TPA, clean and test fire under BLSM program price of \$20 + S&H.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		8/23/2011
	Product Type		RF
	Action Type]	A
	Assigned To		T.NAGLE
Cause	4015	Improper Maintenance	
Barrel	Description]	22" 3006 SPRG
	Date Code]	OI
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6486&Type=Case

8/26/2011

1	Muzzle/Crown	Slightly Worn;	٦
	Condition	Functioning	
Bolt		Slightly Worn;	=
	Firing Pin	Functioning	
	G1 1	Slightly Worn;	
	Shroud	Functioning	
	Face	Slightly Worn;	
		Functioning	╡
	Handle	Slightly Worn; Functioning	
		Slightly Worn;	=
<u> </u>	Stop	Functioning	
		Slightly Worn;	=
	Condition	Functioning	
Extractor .	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Not Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
	Description]	M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	Select	.009
Sear	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	16313	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY,PARTS WORK SLUGGISH.WILL FOLLOW DOWN
	Pull	Select	9#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

22" 017/76 9#

8-16-2011

Remington Attn: Consumer Repairs 14 Hoefler Ave Ilion, NY 13357

Dear Sirs,

 
Enclosed you will find a Remington 700 with the serial number A6334905. According to the customer, the firearm sometimes discharges when the bolt is closed and the trigger is not pulled and the action is loose in the stock. When the repair is complete, please return the firearm to the following address:

Cabela's 475 E Hartford Blvd North East Hartford, CT 06118 Attn: Repair Return

Thank you for your prompt attention to this matter.

Kalé Meyer Firearms Administrator Cabela's East Hartford Retail (860) 290-6200 x8211





T.A. dirty + hps A sticky lube
Risi Due chus ing parts to work
sluggish. Replace TPA, clant
Test fire under SCP Roil
870.00 + Ship

Quote

