Remington Arms Co., Inc. **Product Service** Legal Case #:6363

Case		

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete 7/18/2011 235507 7/12/2011 7/18/2011 Customer Information Type Business First Name Last Name Street City State Zip Contact 11217 NW 4th Ct. LD Daily Vancouver WA98685 H 360-991-2444 Reporter C 360-904-3751 Incident Terry Cockrum E tcockrum@comcast.net Incident Information Claims Codes Repair Est. **Medical Treatment Medical Status** PΙ

PD Cause: 4006 Altered Adjustments or Components

Unknown

Concern: 1007 Fired on Safe Release S

C FSR

Customer stated in a note they had a FSR. No mention of damage or injury. df

Firearm Information

Mfg. Type Model/Ga. SKU Remington CF/BA 700/243 WIN 27474 **Original Owner Date Purchased** Where Purchased Accessories

E6299312 OQ 7/31/1996

DOM

Bbl.

Scrial

WAL MART WAREHOUSE #3R TWO PIECE BASE U

CONCERN: FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date

Reimbursement

Cash Settlement Reim. Date Cash Date APV APV

Per Ilion - Quote to repair

Repair/Replacement Cost Repair/Replacement Date

7/26/11: Per Ilion - TA set screws altered & trigger not returning properly. Can offer to replace TA, clean & test fire for 1/2 normal cost quote. Customer called in & apprvd repair & pd by credit card. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
Examination	Exam Date		7/18/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
Barrel	Description		22" 243 WIN
	Date Code		OQ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6363&Type=Case

7/26/2011

	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	LITE RUST ON BBL
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
	Description		M/700 SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.012
	Notch	Slightly Worn; Functioning	
	T- 4-	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG NOT RETURNING PROPERLY WILL FOLLOW DOWN
	Pull	Select	1.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

22" 00 1/96 1.5th

Hoblem

When it on Salety
and is carked flip
Salety of and autimaticy
discharges

P.S.

not good!

Terry Cockrum

360) 904-3757 - Cell

tcockrama concestinet

E6299312

Model: 700

RE00235507

IUL	[2]	1	WI	
JUL	2	0	2011	

BY:....

T.A. set screws Altered. Trig. Not returning properly. CAN offen to replace TOA, cleared Test Rive at (fr von wal cost.

Quote







