Remington Arms Co., Inc.
Product Service
Legal Case #:6317

Case Information

RE# Date Opened Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete 235742 7/15/2011 6/29/2011 7/18/2011

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact
Incident Doug Dorr 318 E. Stanton Ave Columbus OH 43214 C 614-668-7798

Incident Information

Claims Codes Repair Medical Medical Status.

PI PD

Cause: 4038 Could Not Duplicate Concern

Fires when you smack side

Concern:1006 Unexplained Discharge Safe

Unknown

of receiver

^

6/28/11 Per call from Dorr, he was told to check his trigger out. Sometimes he can cock the bolt, take the safety off and it will fire when you smack the side of the receiver.cm

Firearm Information

Model/Ga. **SKU** Serial Bbl. DOM Mfg. Type Remington CF/BA 700/30-06 SPRG n/a B6389336 EC 10/1/1982 Original Date Where Purchased Accessories Owner Purchased NATIONWIDE SPTS SOUTHAMPTON TWO PIECE N PA **BASE**

CONCERN: FIRES WHEN BUMPING STOCK

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Settlement Release Date Reimbursement Release Date Reimbursement Release Date Reimbursement Settlement APV APV

Per Ilion, offer to replace TPA, clean, test fire at 1/2 normal cost

Repair/Replacement Cost Repair/Replacement Date

7/1/11 Mailing box and ARS from Corporate.cm 7/20/11 Per Ilion, could not duplicate concern. Can offer to replace TPA, clean, test fire at 1/2 normal cost. Estimate mailed. Dorr asked that we not ship this week since he's on vacation. He'll have the estimate when he gets back.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment	
	Examiner		B.TRAVIS	
	Exam Date		7/18/2011	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6317&Type=Case

4/25/2012

	Product Type	_	RF	
Examination	Action Type	Action Type		
	Assigned To		T.NAGLE	
Cause	4038	Could Not Duplicate Concern		
	Description		22" 3006 SPRG	
	Date Code		EC	
	Bore Plugged	False	·	
Barrel	Bulged	False	=	
	Fired	False	7	
	Fired while Obstructed		_	
	Muzzle/Crown Condition	Slightly Worn; Functioning	7	
	Firing Pin	Slightly Worn; Functioning	1	
	Shroud	Slightly Worn; Functioning	1	
Bolt	Face	Slightly Worn; Functioning	†	
	Handle	Slightly Worn; Functioning	1	
	Stop	Slightly Worn; Functioning		
	Condition	Slightly Worn; Functioning	= 1	
Extractor	Cut Condition	Slightly Worn; Functioning		
	Ext/Eject Test	False	1	
	Block Condition	Select	1	
Locking Locking	Lug Condition	Slightly Worn; Functioning		
Looking	Notch Condition	Select		
741	Exterior Condition	Slightly Worn; Functioning	1	
Overall	Stock Condition	Slightly Worn; Functioning		
	Fore End Condition	Select		
	Condition	Slightly Worn; Functioning	~~	
Receiver	Bulged	False		
	Description		M/700 SAFETY	
Safety	Function	Like new; Functioning		
	Sub-Assembly	Non-ISS		
Sear	Lift	Select	.015	
	Notch	Slightly Worn; Functioning		
		Test Fired	False	
Feeding Test	Tests	False		
Trigger	Condition	Slightly Worn; Functioning		
	Pull	Select	4#	
	Altered	True	SET SCREWS ALTERED	
	Sub-Assembly	M/700 Non-Bolt Lock		
Non-Remington Components	Description		TWO PIECE BASE	

ELIOKE OIS

6317

June 29, 2011

Doug Dorr 318 E. Stanton Ave. Columbus, OH 43214

Subject: Case #6317, Model 700

Dear Mr. Dorr,

Thank you for your patience. Enclosed is the UPS ground prepaid shipping label to cover shipment of the firearm for inspection at our factory. Please include a copy of this letter with the firearm. The letter inside is important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly. Please mark the ends of the box with "Product Service".

I apologize for the inconvenience and I hope that these actions will keep you a loyal Remington customer.

Sincerely,

Christy Mitchell

Consumer Affairs Administrator Phone: 800-243-9700, ext 8684

christy.mitchell@remington.com

DECERVED L JUL 2 0 2011

could not duplicate concern can often to replace TPA, clean 17251 fine at 1/2 Normal 2051.

Quake

B6389336 Model: 700 RE00235742

Remington Arms Company, Inc. • 870 Remington Drive • P.O. Box 700 • Madison, NC 27025

Phone 800-243-9700 • www.remington.com

Model Number: 700 LH	Serial Number: B6386	Serial Number: B6389336		
Are you the original owner?: YES X	10			
Name: Doug Dorr	Date of Purchase: 20	98		
Address (no PO Boxes): 318 6. 5	tauton Ave			
city: Columbus	State: OH	Zip: 43 114		
Phone (Daytime): 614-668-7798	Fax:			
-mail Address:(if e-mail address is provided, no				
sent) luyango @yahoo, com		·		
E-mail Address:	<i>t</i> .			
X I would like to receive future e-mail updates f	rom Remington.			
Please describe your problem and date of occu	Irrence:			
About Sume 27, 2011 Got	out to clean and aid	test, tapping		
trigger and bumping stock				
it dry fired. Had I	nore than 2 failur	1 Mars sur		
	de la company de	23 - 700000 37100		
have occuped.				
Also noticed recoil tang	between barrel and	reterior appe		
Also noticed recoil tang to have a crack. Is 1	this something to be	concept of		
		Les nes acou		
		<u> </u>		
500 characters left		• • • • • • • • • • • • • • • • • • • •		
ummunition Information:				
Manufacturer: Winclester	Type: Super X	, 1		
Other (i.e. bullet weight/type, shot size, powder):	150 gr. /180 gr.			
landload Information:				
Powder Used:	Powder Weight:			
Case/Hull Used:	1			
	Primer Used:			

Firearms Care (Cleaning and Lubrication): How often do you clean the bore? (Months or Number of rounds) about 20 rounds How often do you clean the action? (Months or Number of rounds) about 20 minds How often do you clean the trigger assembly? (Months or Number of rounds) bost 40 rounds Brand of lubricant used: | Rem Oil How often do you lubricate the bore? (Months or Number of rounds) How often do you lubricate the action? (Months or Number of rounds) 20 rounds or before startice How often do you lubricate the trigger assembly? (Months or Number of rounds) 1 about 40 rounds Have you reviewed the cleaning and maintenance recommendations on our web site or in our owners manual? YES T NO When was the last time that your firearm was serviced by a Remington authorized repairmen/gunsmith?) Not to my knowledge What were the services performed?) Remington Arms Co., Inc. Attn: Arms Service Division 14 Hoefler Avenue Ilion, NY 13357 (SWARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM. :: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.) :: Remove all accessories from your firearm to prevent loss or damage. :: Provide a return address on both the outside and inside the box. Shipments without a proper return address will be refused.



Remington Arms Company, Inc. 870 Remington Drive P. O. Box 700 Madison, NC 27025-0700

ARS LABEL REQUEST FORM

DATE:	6/.	29/2011 REQUESTED B	Y: christy	
QUANTITY:	1	WEIGHT PER F	PACKAGE:	10
PLEASE CHECK ONE				
MEDIA				
COORDINATOR			xxx	
TO MAIL		I WILL MAIL		
DESCRIPTION:				
		700		
B63893	36			

LABEL INFORMATION

MAIL LABEL TO: Doug Door
318 E. Stanton Ave
Columbus, OH 43214
614-668-7798

RETURN ITEM TO: Rem Prod Serv
Case # 6317

PLEASE COMPLETIE ALL PARTIS OF THIS FORM AND SENDITO THE MEDIA COORDINATOR

4XX596 JUN 30, 2011 ALL CURR USD 1 OF 1 SVC GNDCOM ACT WT 10.0 LBS
TRACKING# 1Z4XX5969067759890
REF 1:DOUG DOOR/CD/CM
REF 2:700/B6389336

HANDLING CHARGE 0.00
SINGLE-PIECE PUB RATE CHRGS: SVC T/P USD PUB 0.00 RS 0.50
DC 0.00 DGD 0.00 SD 0.00
DC 0.00 PR 0.00 SP 0.00
TOT PUB CHG 9.12 PUB+HANDLING 9.12







