

Remington Arms Co., Inc.  
Product Service  
Legal Case #:6975

## Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
247700	11/22/2011	12/5/2011	12/5/2011				

## Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	EJW Outdoors		EJW Outdoors	4667 B Arendell	Morehead City	NC	28557		

## Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	Fires when going from Safe to Fire	Cause:4006 Altered Adjustments or Components Concern:1007 Fired on Safe Release	Unknown	
C				

12/20/11 Per note on repair, fires when going from safe to fire.cm

## Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/308 WIN	n/a	B6403872	DC	9/14/1982
Date Purchased	Where Purchased	Accessories	Original Owner			
	J W MUR CO WILMINGTON N C	SCOPE BASE,RINGS,SCOPE	U			

CONCERN: FSR

Ammunition Information - None Defined

Other Products Information - None Defined

## Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, can offer to replace TPA, clean, test fire at 1/2 normal cost						
	Repair/Replacement Cost	Repair/Replacement Date				

12/20/11 Per Ilion, could not duplicate concern. Trigger assm dirty and sticky and set screws altered. Can offer to replace TPA, clean, test fire at 1/2 normal cost.cm

## Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/5/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		18.5" 308 WIN
	Date Code		DC
	Bore Plugged	False	
	Bulged	False	
	Fired	False	

	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	BBL HAS BEEN CUT OFF AT MUZZLE
	Stock Condition	Slightly Worn; Functioning	FINISH ALTERED
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	N/A
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY SAFETY DETENT RETAINER CLIP MISSAMM
	Pull	---Select---	3#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		SCOPE BASE,RINGS,SCOPE

D183856XPII		Friday, Dec 2 2011		9:22 AM	
D185 - Flood	SAP 10:00 - 10:10	Mailroom Exit	COPIES	9:25 AM	

100

could not duplicate concern.  
T. A. dirty + set screws altered.  
CAIV offer to replace TPA, clean  
+ reset fire at 1/2 original cost

RECEIVED  
DEC 06 2011

BY: \_\_\_\_\_









