

Remington Arms Co., Inc.
Product Service
Legal Case #:6790

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
245479	11/2/2011	11/3/2011	11/3/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		James	Elsa	34 Maple Ave	Wolcott	CT	06716		

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015	Improper Maintenance		Unknown
S	Fired on bolt closing	Concern:1008	Fired on Bolt Closing	
C				

11/17/11 Per note on repair, gun fires when bolt is closed.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	6655053	PX	6/1/1973
Date Purchased	Where Purchased	Accessories	Original Owner			
	JERRYS SPORT SHP OLYPHANT PA		U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean and test fire at BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	42.40	11/17/2011				

11/17/11 Per Ilion, trigger assem is contaminated with a dried lubrication residue causing the trigger to bind. Replace TPA, clean and test fire at BLSM program price of \$20 + shipping.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		11/3/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4015	Improper Maintenance	
Barrel	Description		22" 3006 SPRG
	Date Code		PX
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	RIFLE COATED WITH A DRIED LUBE RESIDUE
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.007
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Not Functioning	DRIED LUBE RESIDUE CAUSING TRIGGER TO BIND
	Pull	---Select---	10+#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	

File Add Repair Estimate Repair Expedite Repair Inquiry Repair Tools CSR Tools Reports Table Maintenance System Location

frmREInquiry - Repair Inquiry

Repair Number: RE00245479

Serial: 6655053 Model 700 30-06 SPRG SKU: 20000

Repairman: Charles Swanson

Verify Repair

Status: Estimating 11/2/2011 7:23:19 AM

ADDRESS INFORMATION

Customer

☒ Received from

Return To

☐ Received from

Name: JAMES ELSEA

JAMES ELSEA

Address 1: 34 MAPLE AVE

34 MAPLE AVE

Address 2: PO Box:

PO Box:

City: WOLCOTT

WOLCOTT

State: CT Zip Code: 06716-3312 Country: US

CT Zip Code: 06716-3312 Country: US

FFL:

Contact / Condition Problems Estimate History / Status Shipping / Billing

Problems Reported

Code	Desc
M239	REPLACE TRIGGER ASSEM.

Problems Found

Code	Desc
M123	FORWARD TO PRODUCT SE

Repair Search

Repairman's Comments

CSR Comments

GUN FIRES WHEN BOLT IS CLOSED.

Refresh

Close

6655053
Model: 700

RE00245479

RECEIVED
NOV - 8 2011

BY:

T.A. is contaminated with
advised lubrication residue
causing the Trig. to BIND.
Replace TPA clean + Test fire
under BLP for 2000 + ship
Quote

22
PX673
1007

6790





