

Remington Arms Co., Inc.
Product Service
Legal Case #: 7151

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
250225	12/13/2011	12/28/2011	12/28/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	TP Outdoors	Bobby	James	101 Mill St	West Monroe	LA	71291		W 318-322-4474 F 318-388-2979
Incident		Gary	Hamilton	3501 Cyprus St	West Monroe	LA	71291		E gary.hamilton@bxs.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
--------	-------	-------------	-------------------	----------------

PI

PD

S goes off
unexpectedly

C

per ltr. gun goes off unexpectedly

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/7MM REM MA	20000	B6277313	RA	11/20/1980
Date Purchased	Where Purchased	Accessories	Original Owner			
	SPORTS SOUTH SHREVEPORT LA		U			

CONCERN: GOES OFF UNEXPECTEDLY

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
------------	-------------------	--------------	---------------	-----------------	----------------	---------------

Replace TPA under SMP at
1/2 normal cost

Repair/Replacement Cost	Repair/Replacement Date
-------------------------	-------------------------

\$29

per ltr: could not duplicate concern. TA set screws altered. rifle has a max headspace condition. Replace TPA, under BLP for \$20. Repair headspace condition at 1/2 normal costs.

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B. TRAVIS
	Exam Date		12/28/2011
	Product Type		RF
	Action Type		A
	Assigned To		T. NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		24" 7MM REM MAG
	Date Code		RA
	Bore Plugged	False	
	Bulged	False	

	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Worn; Functioning	HAS A MAX HEADSPACE CONDITION
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.006
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	---Select---	3.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	

TP OUTDOORS
101 MILL ST
WEST MONROE LA 71291
318-322-4474
FAX 388-2979
12-05-2011

7151

24"
RA11/80
3.5"
1006

REMINGTON ARM'S
THIS 700 ADL SN.B6277313 GOES OFF UNEXPECTEDLY

THANKS

BOBBY JAMES
GUN SMITH

CUSTOMER
GARY HAMILLTON
318-323-9767

RECEIVED
JAN 24 2012
BY:

Serial
Number

B6277313

Model: 700



RE00250225

could not duplicate concern.
T.A. set screws altered. Rifle
was a max headspace condition.
Replace TPA, under BLP for \$20.00.
Repair headspace condition at
1/2 normal costs.

Quote





