Remington Arms Co., Inc.
Product Service
Legal Case #:7117

Case Information

 RE#
 Date Opened
 Date Opened(PS)
 Date Closed
 Incident Date
 Pre Lit
 Lit
 Obsolete

 251063
 12/19/2011
 12/20/2011
 12/20/2011

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact

Reporter Rocky Mt Discount Sports Rocky Mt Discou 440 Broadway Sheridan

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

PD Cause:4038 Could Not Duplicate Concern

S Fired when closing bolt Concern:1008 Fired on Bolt Closing
Unknown

C

1/16/12 Per note with rifle, customer brouth in gun firing when bolt is closed.cm

Firearm Information

 Mfg.
 Type
 Model/Ga.
 SKU
 Serial
 Bbl.
 DOM

 Remington
 CF/BA
 700/223 REM
 20000
 258653
 LP
 2/1/1967

Date Purchased Where Purchased Accessories Original Owner

SCOPE,RINGS,TWO PIECE BASE U

CONCERN:FBC

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Reim. Cash
Settlement Date APV Date APV

Per Ilion, replace TPA, clean, test fire at BLSM program price

Repair/Replacement Cost Repair/Replacement Date

30.40 1/16/2012

1/16/12 Per Ilion, could not duplicate concern. Trigger assm set screws altered. Replace TPA, clean, test fire at BLSM program price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
Examination	Exam Date		12/20/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
	Description		24" 223 REM HB
	Date Code		LP
	Bore Plugged	False	
Barrel	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	7

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7117&Type=Case

1/16/2012

lı			≒
Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	MAG BOX SPACER MISSING
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
D	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	_
	Description		M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	Select	N/A
Sear	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Functioning	DIRTY TRIG HAS A MIN RETURN
	Pull	Select	2#
Trigger	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE,RINGS,TWO PIECE BASE

Customer Lori Gills 307-674-2165 7117

	₹4, _.
	L92/61
JOB NO	2些

REPAIR INVOICE

DATE IN	DATE FINISHED	DATE NOTIFIED	DATE PICK	CKED UP/CUSTOMER INITIALS SHIPPING /TRACKING #					
NAME ROKUN STREET	Nountain s	Discornt Su		307-672-	WORK PI	HONE			
440 P	broadway		E-IVIP	· · · · · · · · · · · · · · · · · · ·					
Sherman			STAT	· Wt			8280		
Renungio		700	SERI	258653		CAL./GAI			
WORK PERFORM	MED:				QUANTIT	Y/HRS PR	ICE/EA.	TOTAL PRICE	
Custor	mer br	bught	W-			-			
<u>Ow</u> y	1 FIVIN	g when	1 DOT	t is closed					
							·.		
"				<u> </u>					
12586	53	•						6	
Model: 7	700			could not d	nlic	rale 1	OALO	011)	
				J.A. Set SCRI	1,	/ /	/	ephree	
				TOA, CLEAN		7	eur	den	
				RLP RONX					
RE	E0025	1063							
	·	<u> </u>			0	Luple			
								:	
· · · · · · · · · · · · · · · · · · ·				mag. Bol Si	nicer	WISIN	9 m	heir	
	······································		·····	lec's				· · · · · · · · · · · · · · · · · · ·	
SEE ATTACHED L	IST .					TOTAL	PARTS		
	CEIVED WITH REPAI	R JOB:		PAYMENT METHOD:		TEST A	ммо		
_		LING MAGAZ		☐ CASH ☐ CHECK☐ CREDIT CARD		ADD SALES	TAX		
□ CASE □ C □ OTHER	USTOMER'S AMMO) (ROUNDS)		PAYMENT DUE:		SUB TO	OTAL		
_	NDITION ON ARRIV	<u>AL</u> :				LABOR			
				NECE.	I W I	POSTA			
				L DEC 2	2 2011	MISC. NON-T	AXABLE		
		• .		BY:	ŕ	SUB TO NON-T		1.23	
076-100-358 R109	. *	White Cr	opy - Keep	Canary Copy-To Customer		TOTAL			

- www.usatoday.com/.../2010-10-20-remington-700-trigger-cnbc_N.htm
- www.dailymail.co.uk/.../Deaths-linked-alleged-Remington-Model-700-rifle-defects.htm
- www.newsinferno.com/
- http://www.americas-watchdog.com/another-lawsuit-alleges-remington-model-700-misfire/
- http://www.mmmpalaw.com/CM/Articles/Remington-700-Rifles-Pose-Dangerous-Risk-to-Consumers.asp

Defective Design of the Remington Model 700 Rifle

A 10-month investigation by CNBC has found that at least two dozen deaths and more than 100 injuries have been linked to the signature product of an iconic American company.

The Model 700 rifle suffers from a serious design defect, sometimes compounded by manufacturing defects that causes the rifle to fire without pulling the trigger. The source of the defect is an internal component in the trigger mechanism called the "trigger connector." The trigger connector is what allows the gun to fire once the trigger has been pulled. This system is known as the Walker Fire Control System and Remington is the only gun manufacturer in the world to use it.

The problem with the trigger connector is that the resiliently mounted trigger connector is not bound to the actual trigger. This means that when the trigger is pulled and the gun is fired, a gap is created between the trigger body and the connector. Dirt, debris, dried lubricant and other material then can become lodged in this gap, preventing the trigger connector from returning to a secure and reliable position after the gun is fired. This, in turn, can permit the fire control to malfunction to produce a discharge when the trigger is **not** pulled.

The three most common scenarios for the fire control to malfunction are:

When the user moves the safety switch from the "safe" mode to the "fire" mode

When the user loads a new round into the breech (Fire closing the bolt)

When the user cycles the bolt to eject a spent casing (Fire opening the bolt)

ROMANIA

REMAINSTON ARMS CO. LLC & 70 REMAINSTON AVE MADISTON, NC 27025.0700

1-900-245-9700 INFO @ PENIMOTEN. COM





