

Remington Arms Co., Inc.
Product Service
Legal Case #:6632

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
242080	9/29/2011	9/30/2011	9/30/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Scheels	---	Scheels	2101 W. 41st St.	Sioux Falls	SD	57105		W 605-334-7767 F 605-334-8936

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015	Improper Maintenance		
S	Concern:1008	Fired on Bolt Closing	Unknown	
C	FBC & FSR			

Dealer sent gun in w/note. The consumer stated that the gun will fire randomly when closing bolt or taking safety off. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/243 WIN	26905	T6220631	PQ	6/11/1996
Date Purchased	Where Purchased	Accessories	Original Owner			
	BILL HICKS & CO LTD	TWO PIECE BASE	U			

CONCERN:FBC,FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair						

Repair/Replacement Cost Repair/Replacement Date

10/12/11: Per Ilion - TA rusty & set screws altered. Trigger not returning under sear. Replace TA, clean & test fire @ 1/2 normal cost - Quote. Store apprvd quote & pd on open acct. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		9/30/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4015	Improper Maintenance	SET SCREWS ALTERED
Barrel	Description		24" 243 WIN SS
	Date Code		PQ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	

Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Magazine	Condition	---Select---	
	Box Condition	Slightly Worn; Functioning	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.009
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY, RUSTY. TRIG NOT RETURNING UNDER SEAR WILL FOLLOW DOWN
	Pull	---Select---	3.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

6632

24"
PQ6/91
3.5#
009



2101 W 41st St Sioux Falls, SD 57105
Phone (605) 334-7767 Fax (605) 334-8936

September 23, 2011

Remington Arms Co
14 Hoefler Ave
Ilion, NY 13357

Manufacturer: Remington
Model: 700
Serial Number: T6220631
Caliber/Gauge: 243 Win
SO#: 31156

Enclosed is a Remington 700. The owner states that the gun fires randomly when closing bolt or taking safety off. Please inspect and repair as needed.

Sincerely,

Eileen Fritz

Eileen Fritz
Gunsmith Office Manager

Enclosure

T.A. rusty + set screws altered
TRIG, not returning under
SEAR. Replace TPA, clean + test
fire at 1/2 normal cost.

T6220631

Model: 700



RE00242080

RECEIVED
OCT 04 2011

Quote

BY:.....





