Remington Arms Co., Inc. **Product Service** Legal Case #:6594

Case Information

Date Opened(PS) **Incident Date** Pre Lit Lit Obsolete RE# **Date Opened Date Closed** 9/20/2011 9/21/2011 9/21/2011 241140

Customer Information

Business First Name **Last Name** Street State Zip Contact City Age Type Shippelhoute 8141 County Rd 52 Glenn CA 95943 H 530-934-7525 Incident Nora

Incident Information

Repair Medical Medical Codes Claims Est. Status Treatment

PΙ

PD Could Not Duplicate Concern

Concern:1025 Unexplained Discharge - No Mention of Unknown Trigger fires

Safety Position accidentally

C

9/28/11 Per letter with rifle, his trigger fires accidentally and he would like to have this problem taken care of under our safety modification program.cm

Firearm Information

Model/Ga. SKU Serial Bbl. DOM Mfg. **Type** CF/BA 700/3006 SPRG n/a 6735629 CY 4/1/1974 Remington

Date Purchased Where Purchased Accessories **Original Owner**

WESTERN HOEGEE GLENDALE CAL TWO PIECE BASE

U

CONCERN: FIRES ACCIDENTALLY

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Cash Reim. Cash Release of Claims Reimbursement Settlement **Release Date** Date Date Settlement APV APV

Per Ilion, replace TPA, clean and test fire under BLSM program price

Repair/Replacement Repair/Replacement

Cost Date 45.40 9/28/2011

9/28/11 Per Ilion, could not duplicate concern. Trigger assm dirty and set screws altered. Replace TPA, clean and test fire under BLSM program price of \$20 + S&H.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment	
Examination	Examiner		B.TRAVIS	
	Exam Date		9/21/2011	
	Product Type		RF	
<u> </u>	Action Type		A	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6594&Type=Case

9/28/2011

	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
	Description		22" 3006 SPRG
	Date Code	=	CY
	Bore Plugged	False	
	Bulged	False	
Barrel	Fired	False	
	Fired while Obstructe	d	_
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	_
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Worn; Functioning	BOLT WILL NOT CLOSE ON SAAMI OVERMAX
	Notch Condition	Select	
	Exterior Condition	Worn; Functioning	DIRTY,RUSTY
Overall	Stock Condition	Worn; Functioning	SCRATCHES,MARS,DENTS
· · · · · · · · · · · · · · · · · · ·	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Slightly Worn; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.008
	Notch	Slightly Worn; Functioning	DIRTY
	Tests	Test Fired	False
Feeding Test	1000	False	
Trigger	Condition	Slightly Worn; Functioning	DITY,RUSTY
	Pull	Select	4.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6594&Type=Case

9/28/2011

		
Non-Remington	l	l .
Non-Kennington	Description	TWO PIECE BASE
Components	Description	I WO I LECE BI ISE
Components		<u> </u>

6594


22" CY4/74 45#

6/14/11

To; Remington Arms Company Inc.

Attention: Arms Services

From: Nora Shippelhoute 8141 County Road 52 Glenn California 95943

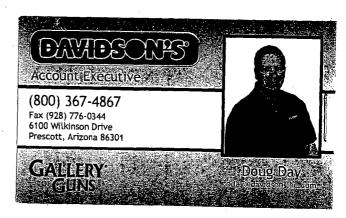

Re: Safety Modification Program

My Model 700 S/N- 6735629, 30-06 trigger fires accidentally and I would like to have this problem taken care of under your safety modification program.

Thank you in advance for your prompt attention to this matter. If you have any questions you can reach me at 530-934-7525.

Sincerely,

Nora Shippelhoute

could not deplicate concern.
T.A. dinky + Set screws Alterd.

Replice TPA cleant TOST BIRE

under SCP Ron \$520.00 + Ship

6735629 SEP 2 8 2011 Model: 700 BY:
RE00241140

