E mbnichols@hotmail.com

Remington Arms Co., Inc. **Product Service** Legal Case #:6867

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete 11/18/2011 247133 11/17/2011 11/18/2011

**Customer Information** 

Type Business First Name Last Name Street City State Zip Age Contact H 740-366-7230 4629 Martinsburg Rd Newark OH 43055 Incident Terry Wright

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PI

PD Altered Adjustments or Components

Unknown

S Concern:1008 Fired on Bolt Closing

C FBC

Customer sent rifle in w/repair form. Customer stated fired when closing bolt & not touching the trigger. df

Firearm Information

Mfg. Model/Ga. **SKU** Type Serial Bbl. DOM CF/BA 700/243 WIN Remington n/a A6657756 DQ 9/11/1978

**Date Purchased** Where Purchased Accessories **Original Owner** 

Y

GILBERT SPT GDS CINCINNATI OH CONCERN: FBC

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Cash Cash Reim. Settlement Release of Claims Release Date Reimbursement Date Settlement Date APV APV

Per Ilion - Quote to repair under BLM

Repair/Replacement Repair/Replacement

Cost Date

\$30.40 12/6/2011

Per Ilion - TA dirty & set screws altered. TA not returning properly. Replace TA, clean & test fire under BLM - quote. Customer apprvd & pd quote. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		11/18/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6867&Type=Case

12/6/2011

		Components	
Barrel	Description		22" 243 WIN ·
	Date Code		DQ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	·
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	· ·
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.009
	Notch	Slightly Worn; Functioning	·
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,TRIG NOT RETURNONG WILL FOLLOW DOWN
	Pull	Select	2#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	·

6867

Serial Number: **Model Number:** A6657756 700 Date of Purchase: Name: Terry Wright Address (no PO Boxes): 4629 Martinsburg RD State: Oh **Zip:** 43055 City: Newark **Phone** Fax: (Daytime): 740-366-7230 E-mail Address: mbnichols@hotmail.com Please describe your problem: Gun has fired by itself when closing bolt without touching the T.A. direty + Set Screws Altered. Tizig. Not returning properly. My Mer TPA, clean + Test Rine Under BLP POR & 20,00 + Pest Quete characters left

NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time.

A6657756 Model:



E OR SPENT SHELLS IN YOUR WITH THE FIREARM. THIS IS A DU FEEL YOU MUST SEND SPENT **EPARATE PACKAGE AND INCLUDE** I, TELEPHONE AND MODEL AND YOUR FIREARM.

our firearm before sending it. vent further damage in shipping and 

firearm box. (Note: Original boxes may not be returned.) :: Remove all accessories from your firearm to prevent loss or damage. :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss

during shipment, so you may elect to purchase insurance from your carrier.

Print

Reset

BY: -----







