Remington Arms Co., Inc. Product Service Legal Case #:7671

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete

5/15/2012 5/16/2012 5/16/2012 267429

Customer Information

Last Name Street City Contact **Business** First Name State Zip Age Type

Incident Michael D. Cintron 90 Appletree Rd. Howell H 917-287-8102

Incident Information

Claims Repair Est. **Medical Status** Codes **Medical Treatment**

ΡĪ

PD Cause:4038 Could Not Duplicate Concern

Unknown

S FBC

Concern: 1008 Fired on Bolt Closing

C

Customer sent rifle in w/note. Customer stated the rifle had a FBC. No reported injury or damage. df

Firearm Information

Mfg. Remington

Type CF/BA Model/Ga.

SKU

Serial Bbl.

DOM

Date Purchased

700/308 WIN 29663

S6702859 OD 7/28/2009 8:27:20 AM

Where Purchased

Accessories Original Owner

ACUSPORT (OH) CORPORATION

U

CONCERN: FBC

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Reim. Cash Cash Settlement Release of Claims Release Date Reimbursement Date Date Settlement APV APV

Per Ilion - Repair at no charge

Repair/Replacement Repair/Replacement Cost

Date

\$83

5/21/12: Per Ilion - Could not duplicate concern. Can offer to replace TA, clean & test to restore confidence in rifle @ n/c. Customer doesn't want a x-mark pro trigger put back on the rifle. I emailed Ilion to see if we could just install a 40-X trigger at n/c. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner]	B.TRAVIS
	Exam Date		5/16/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
		Could Not Duplicate	7

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7671&Type=Case

5/31/2012

Cause	4038	Concern	
Barrel	Description		24" 308 WIN HB
	Date Code		OD
	Bore Plugged	False	
	Bulged	Falsc	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	REC'D WITH REAR TAKE DOWN SCREW UNASSM
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		XMP SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.013
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning]
	Pull	Select	3#
	Altered	False	
	Sub-Assembly	X-Mark Pro	

Thursday, May 10, 2012 1:24 PM

7671

24" 0D 7/00 3t 013

TO REMINGTON ARMS SERVICES 14 HOEFLER AVE ILION N Y 13357

DEAR REMINGTON

MY 700 RIFLE 5R MIL SPEC 3S6702589 IS NOT FUNCTIONING CORRECTLY.
IT IS FIRING WHEN BOLT CLOSES.
PLEASE REPAIR AND RETURN.
I DO NOT WANT THIS TRIGGER ON IT.
PLEASE ADVISE WHICH TRIGGER YOU WILL REPLACE IT WITH.
This is the first unexpected mishap with any of my remington firearms which I,own I have been purchasing your rifle since 1971 and own several.
I,have four of your 700 actions,rangemaster222.50,cdl .300win mag ,5r mil spec .308 and sendaro .223.
Thank you in advance.

MICHAEL D. CINTRON 90 APPLETREE RD HOWELL NJ 07731 917-287-8102

S6702859 Model: 700

RF00267429

could not duplicate concern. CAN offen to replace TDA, clean thest to restone confidence in pufle. At N/C

£ 260974

DECEIVED A MAY 2 1 2012

BY:----







