

Remington Arms Co., Inc.
Product Service
Legal Case #:8059

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
285931	10/17/2012	10/18/2012	10/18/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Ferguson Township PD	Cpl Tim Stringe	Ferguson Townsh	3147 Research Dr	State College	PA	16801		W 814-237-1172 E tstringer@twp.ferguson.pa.us

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038	Could Not Duplicate Concern		
S	Fired on safety release and bolt closing	Concern:1007	Fired on Safe Release	Unknown
C				
11/2/12 Per				

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/308 WIN	25739	G6649951	AB	3/28/2007 1:07:34 PM
Date Purchased	Where Purchased	Accessories	Original Owner			
	AMCHAR WHOLESALE INC (WL)	SCOPE,RINGS,BASE	U			
CONCERN: FSR - FBC						

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, will replace TPA, check over and test at no charge						
	Repair/Replacement Cost	Repair/Replacement Date				
	46.44	11/5/2012				

11/2/12 Per Ilion, could not duplicate concern. As a goodwill gesture to restore confidence in rifle, will replace TPA, check over and test at no charge.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		10/18/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		20" 308 WIN
	Date Code		AB
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		XMP SAFETY
	Function	Slightly Worn; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	N/A
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	SAFETY WORKS SLUGGISH
	Pull	---Select---	5.5#
	Altered	False	
	Sub-Assembly	X-Mark Pro	
Non-Remington Components	Description		SCOPE,RINGS,BASE

8059

P.S. 20"
AB3/07
S.S.

Dear Remington Repairs,

October 12, 2012

Enclosed is a Remington 700 LTR serial number G6649961. We have had three unintentional discharges with this rifle; one when taking the safety off and the other two upon closing the bolt. Each discharge was observed by at least two officers who observed that there was not a finger in the trigger guard or on the trigger.

Please feel free to contact me with any question,

Cpl. Tim Stringer
Ferguson Township Police Department
3147 Research Drive
State College, PA 16801

814-237-1172

tstringer@twp.ferguson.pa.us

RECEIVED
OCT 25 2012

BY:.....

Serial
Number:

G6649951

Model: 700



RE00285931

could not duplicate concern.
As a good will gesture to restore
confidence in rifle will replace
TPA, check out & test at r/c
260974





