Remington Arms Co., Inc. Product Service Legal Case #:7673

				Legal Case#	:7673						
Case Inform	nation										
RE#	Date (Opened	Date Opened(P	S) Date	Closed	Inciden	t Date	Pre	Lit	Lit	Obsolete
267742	5/16/	/2012	5/17/2012	5/17/	/2012						X
Customer I	nformation									_	
Type	Business	First Name	Last Name	Street	City	State	Zip	Age	**	Cont	act 6-6219
Incident		Michael	Dierman	68 Marion Ln	Cantebury	CT	06331				tmail.com
Incident Inf					_						
	Claims		•	Codes	R	epair Es	t. Me	dical Trea	tmen	t Me	dical Status
PI		0-		4 N - 4 D 1: 4 - C							
PD S Fired	l when closi			d Not Duplicate Coloring	oncern			Unknow	n		
C	Wifeli Closh	ing bon Co	meem.1008 Filee	on Bott Closing							
	note with f	irearm, recalled,	gun will go off b	y itself when bolt	is closed.cm						
Firearm Inf	formation										
N	1fg.	Ty	ре	Model/Ga	l•	S	KU	Se	rial	Bbl.	DOM
Rem	ington	CF/	ΒA	XP 100/221 FII	REBA	n/a			493	PG	6/1/1986
Date P	urchased	Where P	urchased	Accessorie	es .	Origin	al Own	er			
CONCERN	I: FBC						U				
Ammunitio	n Informatio	on - None Define	ed								
Other Produ	ucts Informa	ation - None Def	ined								
Settlement											
				Remington/XP 10	00/CF/BA						
5	Settlement	Re	lease of Claims	Release I	ate Rei	imbursen	nent S	Cash ettlement		m. Dat APV	e Cash Date APV
	epair as nee ge under rec						-				
VIA.	50 111011 101		air/Replacemen	t Repair/Repla	cement						
		_	Cost	Date							
5/00/12 D	71. 1 1	1.1	42.71	5/22/20:							
5/22/12 Per	· Ilion, check	c over completel	y. Repair as need	led at no charge un	der recall.cm						
Examinatio	n[Remingto	n/CF/BA]									
									·		
Part		Sub-Par	-t	Coo	le			Co	mmei	ıt	
	Exar	Examiner				B.TRAVIS					
	Exar	Exam Date Product Type				5/17/2012					
Examination	on Prod					RI					
	Acti	on Type				A					
		gned To				Tr i	VAGLE				
lo		-									
Cause	4038	-	Co	ould Not Duplicate	Concern			FIREBAL	•		

PG

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7673&Type=Case

False

False

False

Slightly Worn; Functioning

Date Code

Bulged

Fired

Barrel

Bore Plugged

Fired while Obstructed

Muzzle/Crown Condition

5/22/2012

lı	lles : n:	llanda ny Rode	1
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
D	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		M/XP100 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
-	Sub-Assembly	Non-ISS	
	Lift	Select	.009
Sear	Notch	Slightly Worn; Functioning	
	T	Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Functioning	DIRTY
T :	Pull	Select	2.5#
Trigger	Altered	False	
	Sub-Assembly	Other Remington	

Service Request

Remington Service PO Box 700

Date of Request:

Printed:

Madison, NC 27025-0700

www.Remington.com

ATTN: Product Service

3 document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCUMENT TH YOUR RETURN.

vice Request Number | Serial Number | Description

00019432

5493

'arts and Repairs: P:800-243-9700/F:336-548-7801

Model XP-100 Center Fire Caliber: 221

stomer: MICHAEL DIERMAN 68 MARION LN.

CANTEBURY, CT 06331 US

Destination:

14 Hoefler Ave Ilion, NY 13357 US

Arms Services

Email:

05/07/2012

05/07/2012

Email: KGDRN@ HoTMAIL. Com our request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and urned. If not, you will be contacted with an estimate before work is performed.

eason For Return

123 - FORWARD TO PRODUCT SERVICE FOR INSPECTION

GUN WILL GO OFF BY SELF, WENT BOUT IS CLOSED.

arts And Service Details

Туре

Description

Ôty Needed Warranty

RE00267742

check over completely uppnin as needed AT MY UDDER MCAH

HIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the item(s) ing sent based on the conversation with our representative.

Sub Total:

.00

Est Sales Tax:

.00

Remington Arms Co., Inc. Product Service Legal Case #:7330

Case Information

RE# Date Opened Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete 256225 1/26/2012 1/27/2012 1/27/2012 X

Customer Information

Type Business First Last Name Street City State Zip Age Contact

W 740-592-

Reporter Ohio Valley Trading & Exchange

rading & ___ Ohio Valley ge Tra 25 E. Stimson Ave. Athens .OH 45701 6668 F 740-589-2601

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

PD Cause:4015 Improper Maintenance S FSR Concern:1007 Fired on Safe Release

Unknown

SR# 10093 - Dealer stated gun had a FSR & will not stay cocked. df

Firearm Information

Mfg.

Туре

Model/Ga.

SKU

Serial Bbl. DOM

Remington

CF/BA
Where Purchased

XP100/221 FB Accessories n/a Original Owner B7508182 DV 9/1/1979

Date Purchased Where Purchased

OUTDOOR SPORTS DAYTON OH

U

CONCERN: FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/XP100/CF/BA

Settlement

Release of Claims

Release Date

Reimbursement

Cash Reim. Settlement Date APV Cash Date APV

Per Ilion - Quote to repair under BLM

Repair/Replacement Cost Repair/Replacement Date

\$10

1/30/12: Per Ilion - TA has a partially dried & sticky lube residue causing parts to work sluggish. Check over, repair, clean & test fire under BLM - quote. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment	
Examination	Examiner		B.TRAVIS	
	Exam Date		1/27/2012	
	Product Type	•	RF	
	Action Type		A	
				=

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7330&Type=Case

2/6/2012

	Assigned To		T.NAGLE
Cause	4015	Improper Maintenance	
Description			10.5" 221 FB
Barrel	Date Code		DV
	Bore Plugged	False	
	Bulged	False	
	Fired	False	·
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	·
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
. "	Exterior Condition	Slightly Worn; Not Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
RECEIVE	Bulged	False	
	Description	·	M/XP100 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	.*
	Sub-Assembly	Non-ISS	
	Lift	Select	.010
Sear	Notch	Slightly Worn; Functioning	
	4	Test Fired	False
Feeding Test	Tests	False	·
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY,PARTS SLUGGISH WILL FOLLOW DOWN
	Pull	Select	2#
	Altered	False	·
	Sub-Assembly	Other Remington	

Service Request

Remington Service PO Box 700

Madison, NC 27025-0700



Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service PLEASE RETAIN THIS COPY FOR YOUR RECORDS.

DV9/79

15.5"

Service Request Number | Serial Number / Description

Date of Request:

01/18/2012

SR00010093

B7508182

Date Printed: 01/18/2012

Model XP-100 Center Fire Caliber: 221 FIREBALL Customer:
OHIO VALLEY TRADING & EXCHANGE COMPANY

Destination:

Arms Services

14 Hoefler Ave

Hion, NY 13357 US

25 E STIMSON AVE ATHENS, OH 45701 US Email: ovieterry@yahoo.com

-Your request for service on the item(s) will be evaluated by our repairman. You will be contacted with an estimate before work is performed.

Reason For Return
M123 - FORWARD TO PRODUCT SERVICE FOR INSPECTION

M295 - EVALUATE AND REPAIR

Service Request Section MFD - 1984. Just took gun in on trade. Gun is fixing everytime safety is moved to fire mode withou

Parts And Service Details

Material Type Description

Price Disc Amount NZCZIV

JAN 3 0 2012

B7508182

Model: XP-100



T.A. has A pantially dried + STICKY lube residue causing PANTS to work sluggish Check over, repair, clear + 7057 Line under BCP Con \$ 20, t

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Quote

Sub Total: Est Sales Tax: .00 .00

Grand Total:

\$.00



25 East Stimson Avenue, Athens, Ohio 45701 (740) 592-6668 FAX (740) 589-2601 FFL# 4-31-009-02-9C-13638 (03/01/09)

Date:01/19/2012

Repair Order #STOCK

To:

REMINGTON SERVICE ARMS SERVICES 14 HOEFLER AVE. ILION,NY 13357

Dear Sir:

Please accept the enclosed product for repair. If this work is not covered under your manufacturer's warranty, please advise as to repair cost before proceeding.

Item Description

REMINGTON PISTOL S/N-B7508182 LOG 1601

Product#

XP100 PISTOL 221REM CAL.

Nature of Problem

GUN FIRES WITH SAFETY ENGAGED, GUN DOES'NT HAVE ENOUGH TRIGGER RETURN SPRING, WILL NOT STAY COCKED.

We would appreciate your prompt attention.

Note: When returning product to OVTE, please ship to the above listed address **Attn: Repair Department** and include **Repair Order #** on package.

Sincerely.

Terry Marshall

Ohio Valley Trading & Exchange Company

Athens, Ohio