Remington Arms Co., Inc. Product Service

Legal Case #:8383 Case Information RE# Date Opened Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete 12/18/2012 12/19/2012 12/19/2012 293495 Customer Information Type Business First Name Last Name Street City State Zip Age Contact H 843-615-5983 Winston 1541 Weaver St. Timmonsville SC 29161 Incident Vaught E wallacevaught@gmail.com Incident Information Claims Codes Repair Est. Medical Treatment **Medical Status** ΡĮ PD Cause: 4015 Improper Maintenance Unknown S FSR Concern: 1007 Fired on Safe Release SR# 34747 - Reason for Return: Safety Broken. Service Request Section: Gun discharged when moving safety. df Firearm Information SKU Mfg. Model/Ga. Type Serial Bbl. DOM 7/308 WIN 24743 Remington CF/BA S7616024 EQ 10/14/1996 Original Owner Where Purchased Date Purchased Accessories FABER BROS INC SCOPE BASE, BOTTOM HALF RINGS U CONCERN: FSR Ammunition Information - None Defined Other Products Information - None Defined Settlement Remington/7/CF/BA Cash Cash Reim. Settlement Release of Claims Release Date Reimbursement Date Settlement Date APV Per Ilion - Quote to repair @ 1/2 normal cost Repair/Replacement Cost Repair/Replacement Date 12/20/12: Per Ilion - TA has a dried lube residue causing the sear to bind to side plates, offer to replace TA, clean & test at 1/2 normal cost. df 12/27/12: Customer called & was argumentative about the quote. Quote stands & he agreed to pay it. He did not sound too sure on how to clean his trigger - I mailed him an owner's manual. df 1]

Examination	Reminaton	/CF/RAI

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/19/2012
	Product Type		RF
	Action Type		A
	Assigned To		J.BALIO
Cause	4015	Improper Maintenance	
Barrel	Description		20" 308 WIN SS
	Date Code		EQ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown		

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8383&Type=Case

Page 1 of 2

•	u .		1
	Condition	Slightly Worn; Functioning	<u>.</u>
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning]
Extractor	Condition	Slightly Worn; Functioning]
	Cut Condition	Slightly Worn; Functioning]
	Ext/Eject Test	False	
	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning]
	Notch Condition	Select]
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	DIRTY
D	Fore End Condition	Select	
	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False]
C. C.	Description	J	STANDARD SAFETY
Safety	Function	Like new; Functioning	
	Lift	Select	N/A
Sear	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	16505	False]
Trigger	Condition	Slightly Worn; Not Functioning	DRIED LUBE RESIDUE SEAR BINDS TO SIDEPLATES
	Pull	Select	N/A
	Altered	False	
	Sub-Assembly	Other Remington]
Non-Remington Components	Description		SCOPE BASE, BOTTOM HALF RINGS

Service Request

Remington Service PO Box 700



Parts and Repairs: P:800-243-9700/F:336-548-7801

Madison, NC 27025-0700 www.Remineton.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCUMENT WITH YOUR RETURN.

EQ10/94

Kumber SR00034747

Serial Number / Description

S7616024

Model SEVEN RIFLE Caliber: 308

Date of Request:

Customer: WINSTON W. VAUGHT

1541 WEAVER ST

TIMMONSVILLE, SC 29161 US

14 Hoefler Ave Ilion, NY 13357 US

Destination:

Email: wallacevaught@gmail.com -Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M568 - SAFETY BROKEN

Service Request Section

SAFETY WILL NOT ENGAGE. GUN DISCHARGED WHEN FORCED FROM F TO S. an attempt was made to mur safety Contine thumb pressure. Que had failed to 3 successive rounds.

fire after

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

T.A. has A DRIED Luise " residue causing the sean to BIND TO SIDEPlates, CAM offer to up. TPA, cliANA TOST AT 1/2 change Sub Total:

Est Sales Tax:

.00 .00

Grand Total:

\$.00

BY:_____





