

Remington Arms Co., Inc.
Product Service
Legal Case #:7210

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
252594/252620	1/5/2012	1/6/2012	1/6/2012				X

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Bill	Geck	1525 Comanche Ct	Granbury	TX	76048		E granburygeck@yahoo.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components		Unknown	
S	Fired when closing bolt Concern:1008 Fired on Bolt Closing			
C				

1/24/12 Per note with rifle, rifle has discharged recently after it had been cleaned by gunsmith. Discharged upon closing bolt.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	600/222 REM	20000	A6569810	LQ	2/1/1978
Date Purchased	Where Purchased	Accessories	Original Owner			
	DEL MAR CORPUS SCRSTI TX	SCOPE BASE	U			

CONCERN:FBC

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/243 WIN	20000	267296	LP	2/1/1967
Date Purchased	Where Purchased	Accessories	Original Owner			
		RECOIL PAD SLEEVE	U			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/600/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPAs at BLSM program price						

Repair/Replacement Cost Repair/Replacement Date

60.80	1/24/2012
-------	-----------

1/24/12 Per Ilion, regarding ser number ending in 296, trigger assm set screws altered, trigger not returning properly. Replace TPA, clean and test fire at BLSM program price. RE ser number ending in 810, trigger assm set screws altered. Trigger has min return. Can offer to replace TPA, check over and clean at BLSM program price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/6/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	CHAMBER HAS BEEN RECUT TO 223 REM CAL. NEW CAL SIZE NOT CHANGED ON BBL WILL BENCH CHECK ONLY AFTER

<http://cns03an13.200/nsaann/PrintDisplay.aspx?ID=7210&Type=Case>

1/24/2012

			REPAIR
Barrel	Description		18.5" 222 REM
	Date Code		LQ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
Bolt	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
Extractor	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
Locking	Ext/Eject Test	False	
	Block Condition	--Select--	
	Lug Condition	Slightly Worn; Functioning	HEADING OKAY ON 223 REM CAL
Overall	Notch Condition	--Select--	
	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
Receiver	Fore End Condition	--Select--	
	Condition	Slightly Worn; Functioning	
Safety	Bulged	False	
	Description		M/600 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Sub-Assembly	Non-ISS	
	Lift	--Select--	.009
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG NOT RETURNING PROPERLY WILL FOLLOW DOWN
	Pull	--Select--	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	Other Remington	
Non-Remington Components	Description		SCOPE BASE

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
------	----------	------	---------

Examination	Examiner	B. TRAVIS	
	Exam Date	1/6/2012	
	Product Type	RF	
	Action Type	A	
	Assigned To	T. NAGLE	
Cause	4006	Altered Adjustments or Components	
Barrel	Description	22" 243 WIN	
	Date Code	LP	
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description	M/700 BOLT LOCK SAFETY	
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.007
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG NOT RETURNING PROPERLY WILL FOLLOW DOWN
	Pull	---Select---	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description	RECOIL PAD SLEEVE	

Service Request

Remington Service

PO Box 700

Madison, NC 27025-0700



22"
LPZ/
Z.S.
100'

Parts and Repairs: P-800-243-9700 F-336-348-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. **ENCLOSE THIS DOCUMENT WITH YOUR RETURN.**

Service Request Number SR00007265		Serial Number / Description 267296 Model 700 Center Fire		Date of Request: 12/21/2011 Date Printed: 12/21/2011																	
Customer: BILL GECK 1525 COMANCHE CT. GRANBURY, TX 76048 US Email: granburygeck@yahoo.com		Destination: Arms Services 14 Hoedler Ave Ellen, NY 13357 US Email:																			
Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.																					
Reason For Return M240 - BOLT LOCK SAFETY MODIFICATION																					
Service Request Section BOLT LOCK PROGRAM																					
<table border="1"> <thead> <tr> <th>Material</th> <th>Type</th> <th>Description</th> <th>Qty Needed</th> <th>Warranty</th> <th>Price</th> <th>Disc</th> <th>Amount</th> </tr> </thead> <tbody> <tr> <td colspan="8"> Rifle has discharged recently after it had been cleaned by gunsmith. Discharged upon closing bolt. </td> </tr> </tbody> </table>						Material	Type	Description	Qty Needed	Warranty	Price	Disc	Amount	Rifle has discharged recently after it had been cleaned by gunsmith. Discharged upon closing bolt.							
Material	Type	Description	Qty Needed	Warranty	Price	Disc	Amount														
Rifle has discharged recently after it had been cleaned by gunsmith. Discharged upon closing bolt.																					
Parts And Service Details 267296 Model: 700		T.A. set screws altered, trigger not returning properly. replace TPA, check test fire under BCP for \$20. + ship																			
		Quote																			
RE00252620		<table> <tr> <td>Sub Total:</td> <td>.00</td> </tr> <tr> <td>Est Sales Tax:</td> <td>.00</td> </tr> <tr> <td>Grand Total:</td> <td>\$.00</td> </tr> </table>				Sub Total:	.00	Est Sales Tax:	.00	Grand Total:	\$.00										
Sub Total:	.00																				
Est Sales Tax:	.00																				
Grand Total:	\$.00																				

Service Request

Remington Service

PO Box 700

Madison, NC 27025-0700



18.5"
2.5#
1009

Parts and Repairs: P:800-243-9700 F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. PLEASE RETAIN THIS COPY FOR YOUR RECORDS.

7210

Service Request Number SR00007266		Serial Number / Description A6569810 Model 600 Center Fire		Date of Request: 12/21/2011 Date Printed: 12/21/2011																	
Customer: BILL GECK 1325 COMANCHE CT. GRANBURY, TX 76048 US Email: granburygeck@yahoo.com			Destination: Arms Services 14 Hoefler Ave Ilion, NY 13357 US Email:																		
Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.																					
Reason For Return M240 - BOLT LOCK SAFETY MODIFICATION																					
Service Request Section BOLT LOCK PROGRAM																					
<table border="1"> <thead> <tr> <th>Material</th> <th>Type</th> <th>Description</th> <th>Qty Needed</th> <th>Warranty</th> <th>Price</th> <th>Disc</th> <th>Amount</th> </tr> </thead> <tbody> <tr> <td colspan="8">Rifle has discharged before when <u>unloading</u>.</td> </tr> </tbody> </table>						Material	Type	Description	Qty Needed	Warranty	Price	Disc	Amount	Rifle has discharged before when <u>unloading</u> .							
Material	Type	Description	Qty Needed	Warranty	Price	Disc	Amount														
Rifle has discharged before when <u>unloading</u> .																					
<div style="display: flex; justify-content: space-between;"> <div> <p>Serial Number: A6569810</p> <p>Model: 600</p> <p>RE00252594</p> </div> <div> <p>T.A. set screws altered. Trig has min return. Can often to replace TPA, check over & clean.</p> <p>At the time under BCP Ron.</p> <p>\$20. + ship</p> <p>Quote</p> </div> </div>																					
<div style="text-align: right;"> <p>Sub Total: .00</p> <p>Est Sales Tax: .00</p> <p>Grand Total: \$.00</p> </div>																					





